



STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

ROUTE NO.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.	SHEET NO. 1 2 SHEETS
		Tazewell	9	8	
FED. ROAD DIST. NO. 7	ILLINOIS	FED. AID PROJECT			

Contract Number: 68585

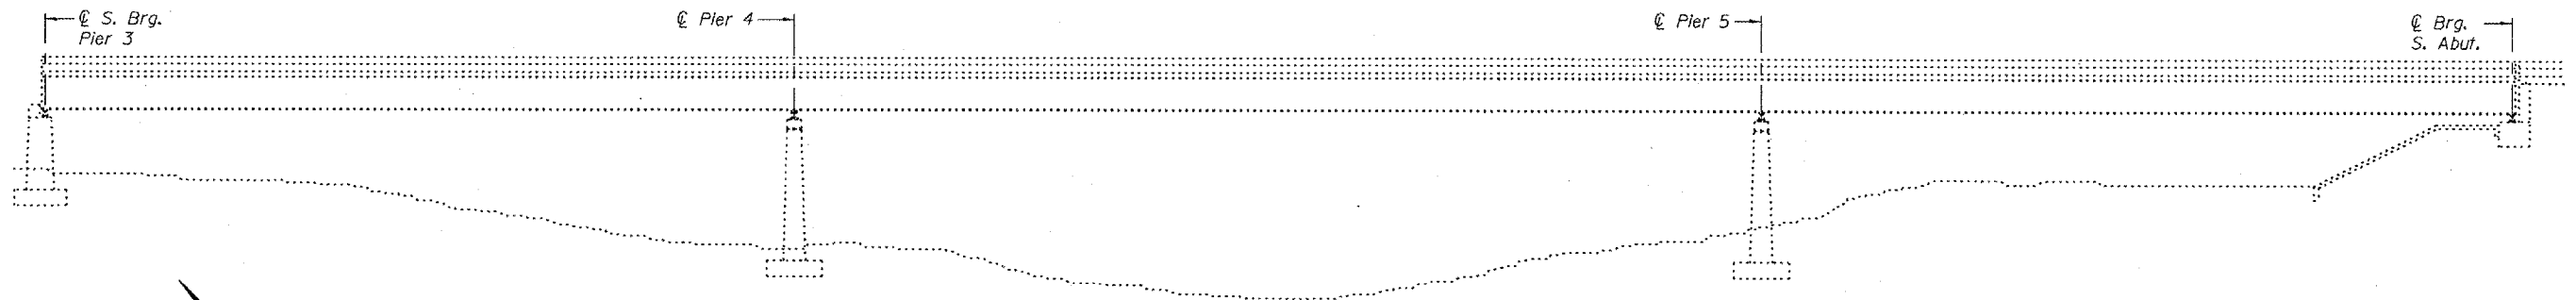

**ELEVATION**

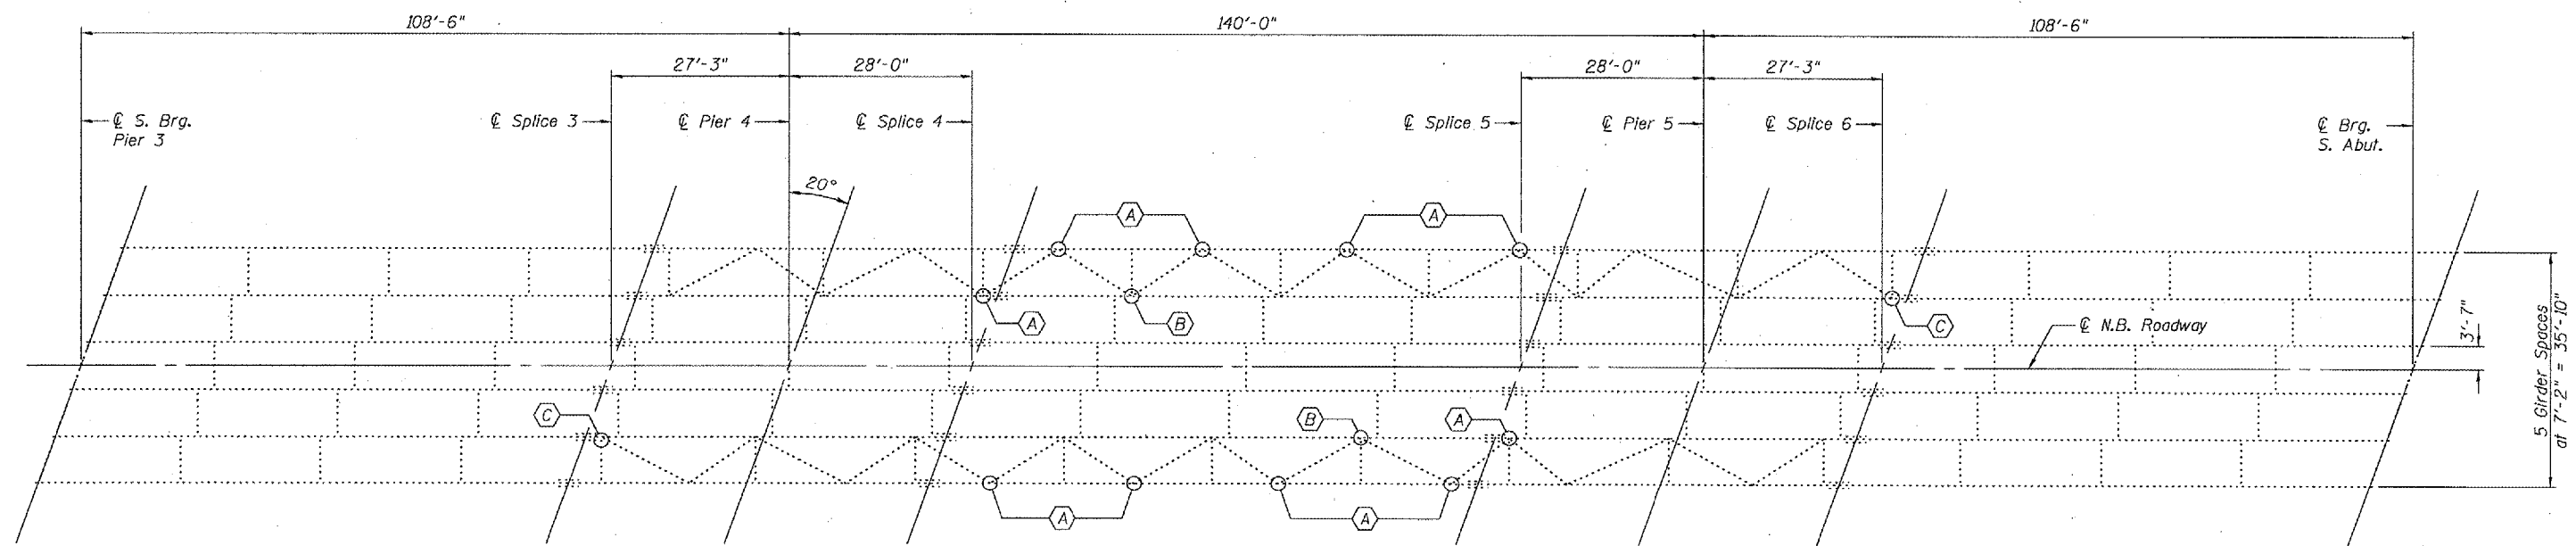

**PLAN**

- (A) Repair Detail A See Sheet 2 of 2.
- (B) Repair Detail B See Sheet 2 of 2.
- (C) Repair Detail C See Sheet 2 of 2.

**GENERAL NOTES**


All structural steel shall conform to AASHTO Classification M-270 Gr. 36, unless otherwise noted.  
Fasteners shall be high strength bolts. Bolts  $T_8\phi$ , open holes  $1\frac{1}{16}\phi$ , unless otherwise noted.  
Plan dimensions and details relative to existing structure have been taken from existing plans and are subject to nominal construction variations. It shall be the Contractor's responsibility to verify such dimensions and details in the field and make necessary approved adjustments prior to construction or ordering of materials. Such variations shall not be cause for additional compensation for a change in the scope of the work, however, the Contractor will be paid for the quantity actually furnished at the unit price bid for the work.  
Cost of removal and/or re-installation of all members necessary to complete the work as detailed on the plans and as specified in the Special Provisions shall be included in the cost of Structural Steel Repair. Cost of temporarily supported lateral bracing is included with Structural Steel Repair.  
The existing structural steel coating contains lead. The Contractor should take appropriate precautions to deal with the presence of lead on this project.  
Existing structural steel that will be in contact with new structural steel shall be cleaned and painted prior to erection as required by the Special Provision "Cleaning and Painting Contact Surface Areas of Existing Steel Structures".  
All structural steel shall be shop painted with the inorganic zinc rich primer per AASHTO M300, Type 1. Cost included with Structural Steel Repair.

**TOTAL BILL OF MATERIAL**

ITEM	UNIT	QUANTITY
Structural Steel Repair	Pound	1,540

DESIGNED *A. Cianci*  
CHECKED *Paul J. [Signature]*  
DRAWN *[Signature]*  
CHECKED *A.J.H. P.S.J.*

March 1, 2006  
EXAMINED *John A. Morrison*  
PASSED *Ralph E. Anderson*  
ENGINEER OF STRUCTURAL SERVICES  
ENGINEER OF BRIDGES AND STRUCTURES

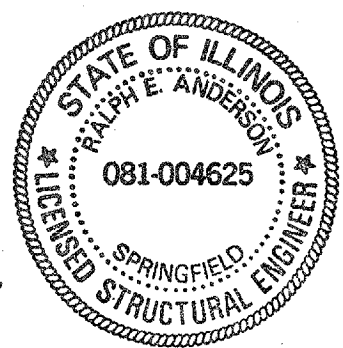

Expires: November 30, 2006

**PLAN AND ELEVATION**  
**I-155 (N.B.) / MACKINAW RIVER**  
**TAZEWELL COUNTY**  
**SN 090-0100**