



## MULTI-LANE DIVIDED PAVEMENT

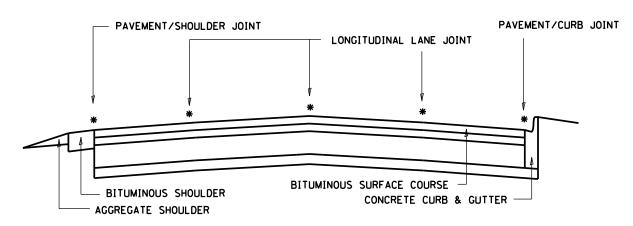

## MULTI-LANE UNDIVIDED PAVEMENT

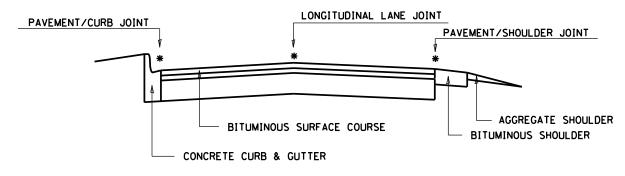


## TWO-LANE PAVEMENT


PROPOSED TRANSVERSE CRACK ROUTING (PAVEMENT) & CRACK FILLING LOCATIONS NOT SHOWN

\* PROPOSED LONGITUDINAL CRACK ROUTING (PAVEMENT) & CRACK FILLING LOCATIONS

GENERAL EXISTING TYPICAL SECTIONS

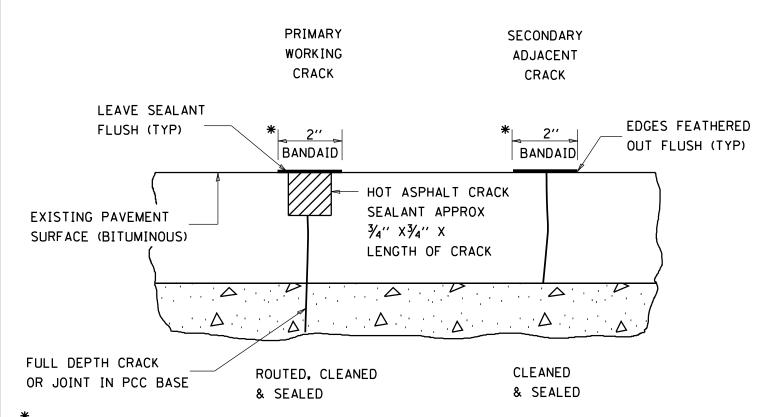

IN ALL LOCATIONS WHERE THE LONGITUDINAL CRACK CONFLICTS WITH EXISTING PAVEMENT MARKINGS (EITHER EDGE LINE OR LANE LINE) THE CRACK SHALL BE ROUTED & THE RESULTING RESERVOIR FILLED WITH SEALANT. HOWEVER, THE 2" BANDAID SEALANT STRIP SHALL BE DELETED TO PREVENT UNNECESSARY DAMAGE TO THE EXISTING PAVEMENT MARKINGS. ALL DAMAGES TO EXISTING RAISED REFLECTIVE PAVEMENT MARKERS SHALL BE REPLACED AT THE EXPENSE OF THE CONTRACTOR. ALL EXISTING PAVEMENT MARKINGS WITHIN THE PROJECT LIMITS SHALL BE RESTORED WITH HOT SPRAY THERMOPLASTIC PAVEMENT MARKINGS.

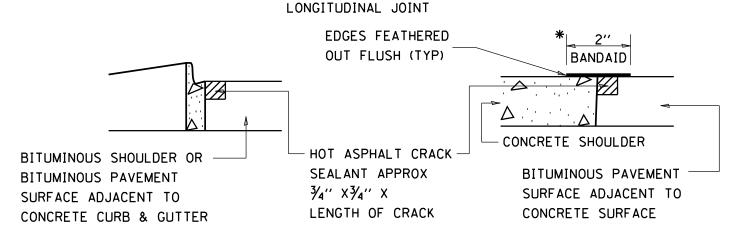

CRACK & JOINT SEALING DETAIL

| FILE NAME =          | USER NAME = Gorengautab      | DESIGNED - | REVISED - | I-94 (LAWRENCE AVENUE TO LAKE COOK ROAD) |                              |  | F.A.I. | SECTION | COUNTY           | TOTAL SHEET |             |
|----------------------|------------------------------|------------|-----------|--|------------------------------|--|--------|---------|------------------|-------------|-------------|
| 0136114-sht-plan.dgn |                              | DRAWN -    | REVISED - | STATE OF ILLINOIS                        | ODACK O JOINT OFALING DETAIL |  |        | 94      | 2014-041I        | СООК        | 34 29       |
|                      | PLOT SCALE = 100.0000 '/ in. | CHECKED -  | REVISED - | DEPARTMENT OF TRANSPORTATION             |                              |  |        | • •     |                  |             | T NO. 60Y35 |
|                      | PLOT DATE = 5/2/2014         | DATE -     | REVISED - |  |                              |  |        |         | ILLINOIS FED. AI |             |             |