



ELEVATION OF MEDIAN BARRIER
(Looking North)

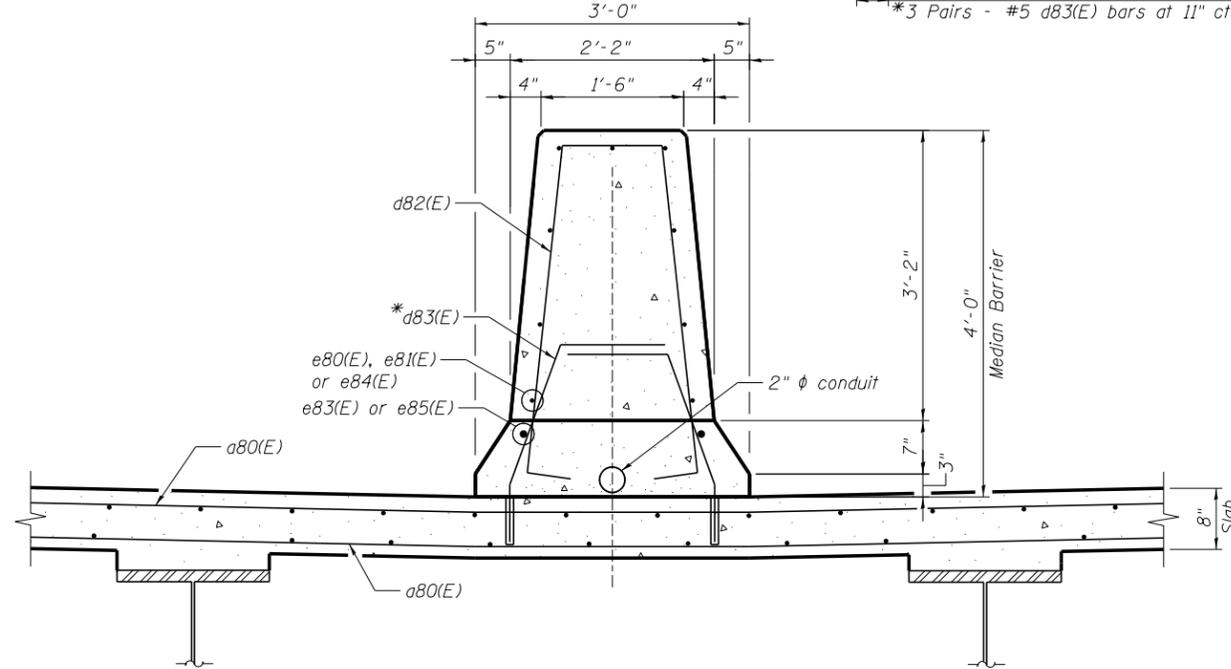


SECTION THRU MEDIAN BARRIER

*Core and set #5 d83(E) bars according to Article 509.06 of the Standard Specifications. Cored holes shall be roughened or scored per manufacturer's recommendations. Maximum depth of hole shall not exceed 6". Cost to be included in Reinforcement Bars, Epoxy Coated.

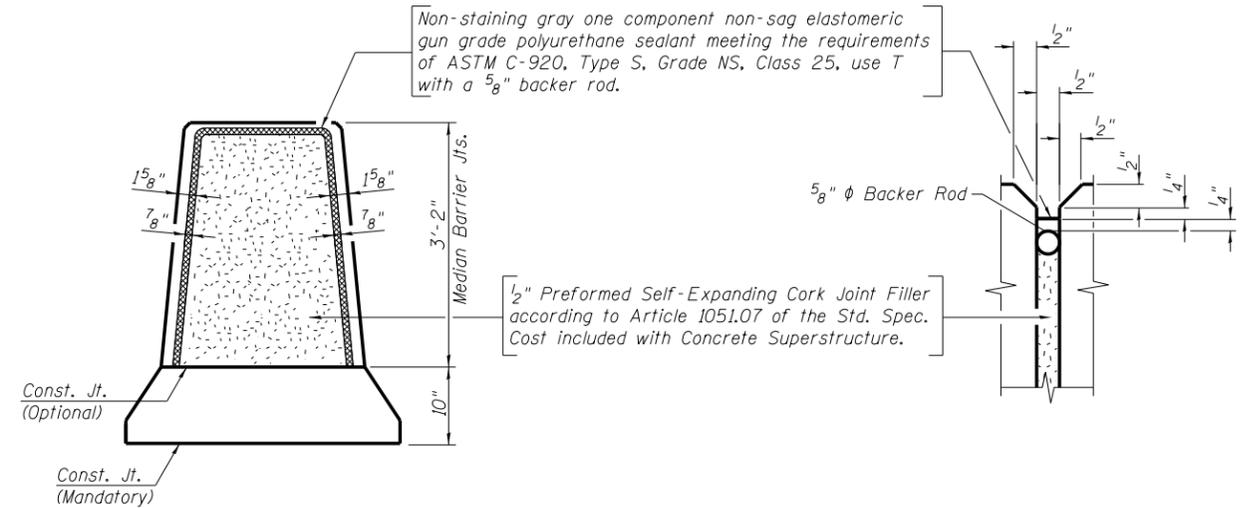

MEDIAN BARRIER JOINT DETAILS

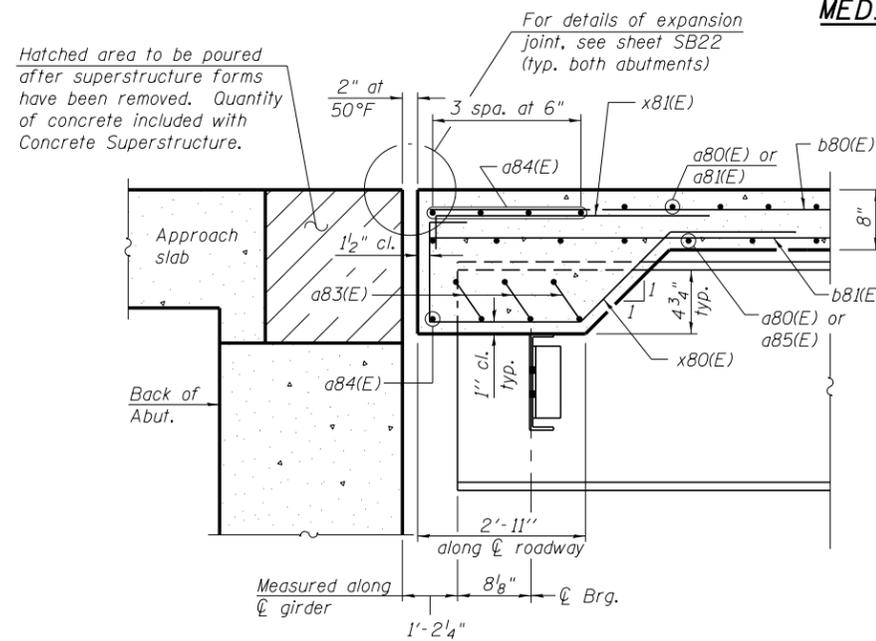

SECTION A-A

NOTE:

The concrete edge beams shall be placed from fascia beam to fascia beam and not on the overhangs of the structure.

benesch
engineers · scientists · planners
Alfred Benesch & Company
205 North Michigan Avenue, Suite 2400
Chicago, Illinois 60601
312-565-0450 Job No. 10056

FILE NAME =	USER NAME = mbecker	DESIGNED - MFB	REVISED -
0900167.68620.18.dkt3.dgn		CHECKED - MRB	REVISED -
	PLOT SCALE =	DRAWN - PRT	REVISED -
	PLOT DATE = 7/16/2012	CHECKED - MRB	REVISED -

**STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION**

**SUPERSTRUCTURE DETAILS 3 OF 3
STRUCTURE NO. 090-0167**

SHEET NO. SB18 OF SB65 SHEETS

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
74	90-[14R(14HB-4,14,14HVB)BR]	TAZEWELL	2433	1929
ILLINOIS FED. AID PROJECT			CONTRACT NO. 68620	