



STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

ROUTE NO. F.A.P. 308	SECTION *	COUNTY ROCK ISLAND	DATE 2/10	SHEET 143	SHEET NO. 28 32 SHEETS
FED. ROAD DIST. NO. 7		ILLINOIS	FED. AID PROJECT		

Contract #64814 \* I(HB,HB-1,VB,HB-2)R

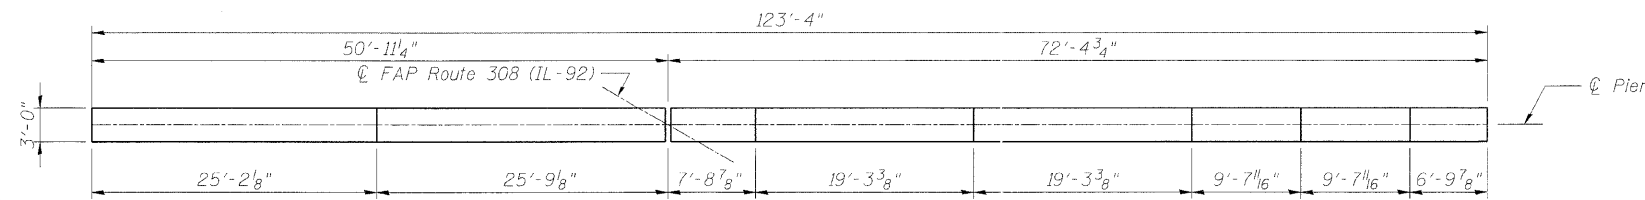

PLAN

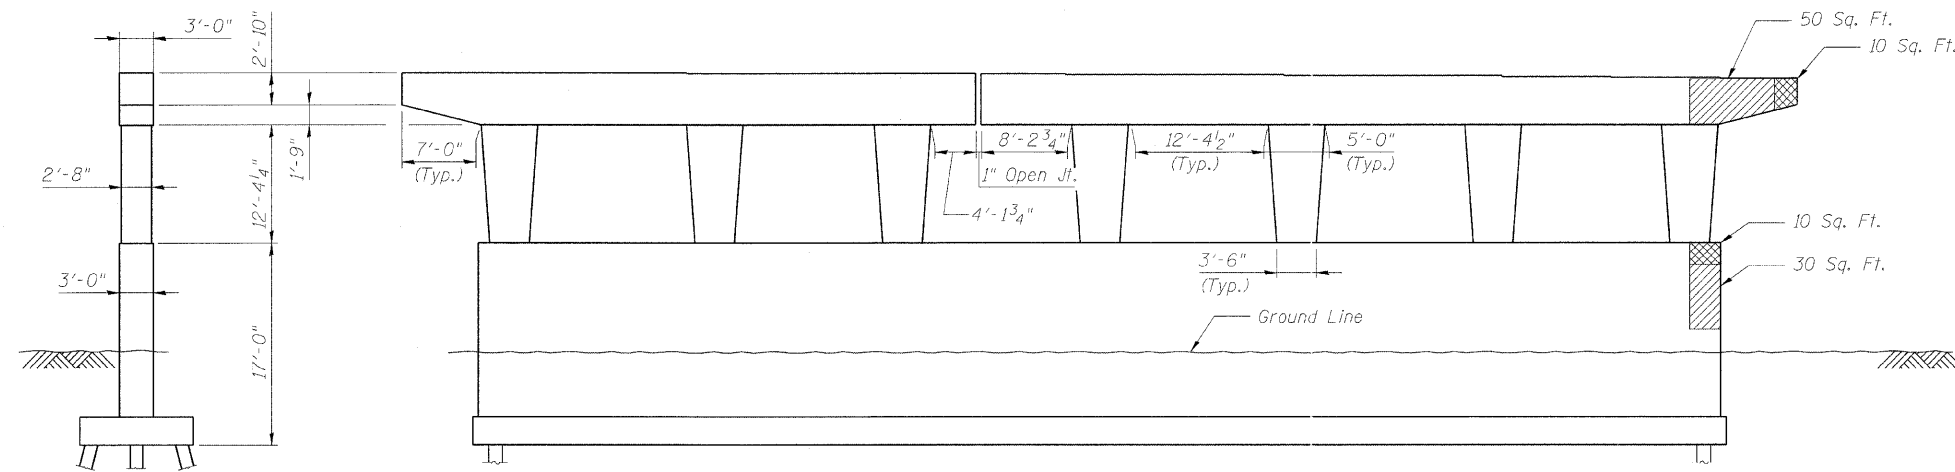


ELEVATION  
(Looking Southwest)

END VIEW  
(Looking Northwest)

LEGEND

- Structural Repair of Concrete  
(Depth Equal to or less than 5 inches)
- Structural Repair of Concrete  
(Depth Greater than 5 inches)

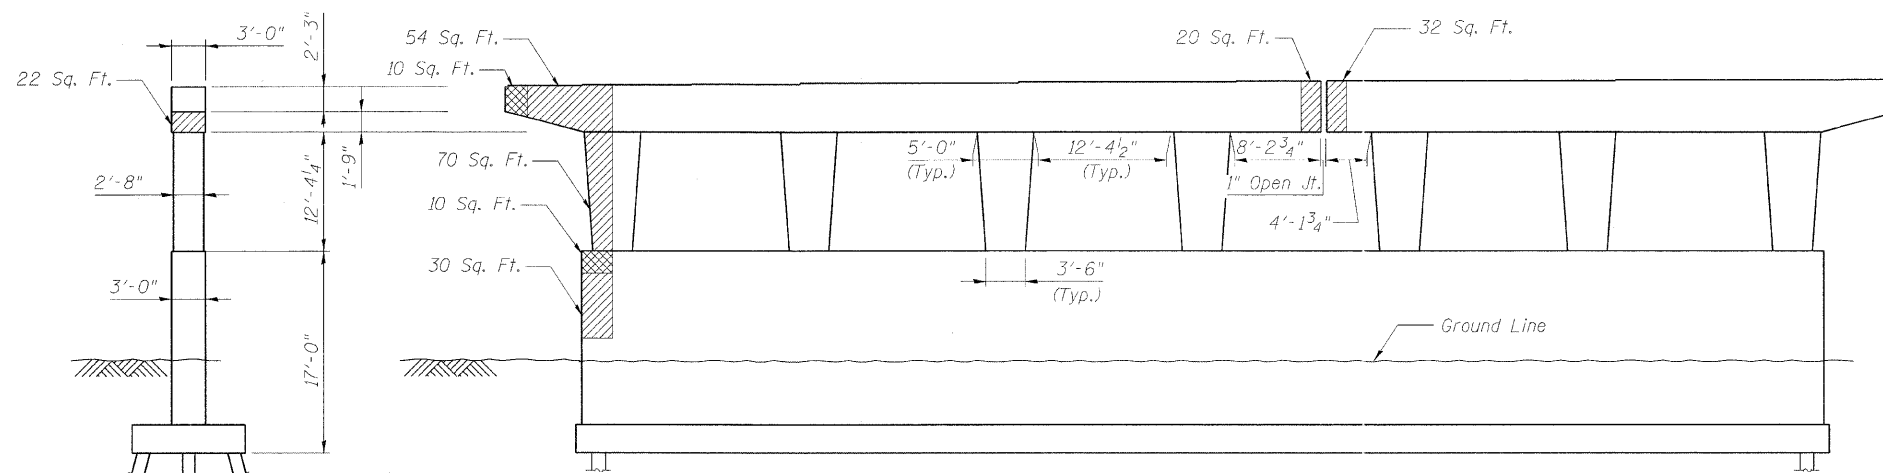

ELEVATION  
(Looking Northeast)

END VIEW  
(Looking Southeast)

BILL OF MATERIAL

Item	Unit	Total
Structural Repair of Concrete (Depth Equal to or less than 5 inches)	Sq. Ft.	308
Structural Repair of Concrete (Depth Greater than 5 inches)	Sq. Ft.	40

Note: Locations of Structural Repair of Concrete shown are approximate. The final locations of the repairs will be determined by the Engineer in the field.

PIER 2 REPAIRS  
IL ROUTE 92 (CENTENNIAL EXPRESSWAY)  
OVER IAIS RAILROAD  
FAP ROUTE 308 SEC. 1(VB)R  
ROCK ISLAND COUNTY  
STATION 1507+04.10  
STRUCTURE NO. 081-0064

DESIGNED JDG  
CHECKED WPK  
DRAWN DCS  
CHECKED JDG



DB STERLIN CONSULTANTS, INC.  
123 N. WACKER DRIVE SUITE 2003  
CHICAGO, ILLINOIS 60606  
TEL. 312/857-1006 FAX. 312/857-1056