


PLAN A EB

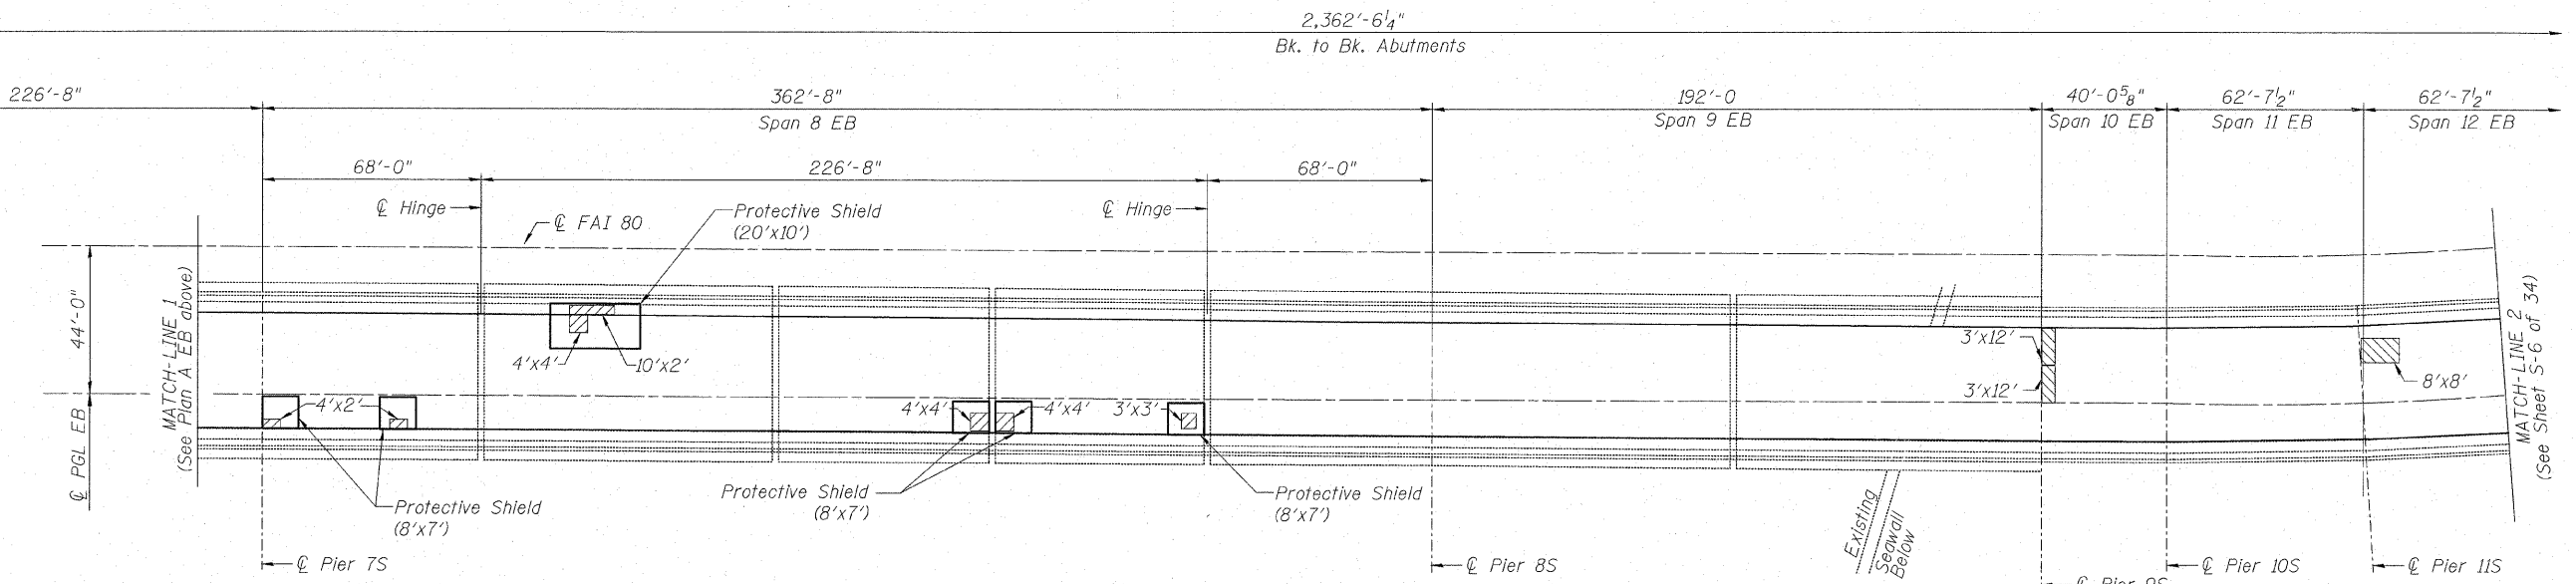

PLAN B EB

LEGEND:

- Deck Slab Repair (Partial)
- Deck Slab Repair (Partial) w/ Welded Wire Fabric *
- Deck Slab Repair (Full Depth, Type II)
- Protective Shield

* Existing wearing surface contains welded wire fabric (WWF 3x3-DBxDB (E)) in east approach spans (Span 10EB through Span 27EB). Remove and replace welded wire fabric when performing deck slab repair. Cost of removing and replacing WWF is incidental to Deck Slab Repair (Partial).

BILL OF MATERIAL

ITEM	UNIT	TOTAL
Deck Slab Repair (Partial)	Sq.Yd.	40
Deck Slab Repair (Full Depth, Type II)	Sq.Yd.	2
Protective Shield	Sq.Yd.	120

NOTES:

1. Areas of proposed deck repairs are estimated. Actual type, location and dimensions of deck repairs are to be determined by the Engineer during construction.
2. Reuse existing drain if drain falls within a full depth repair.