


CONTRACT NO. 60C90

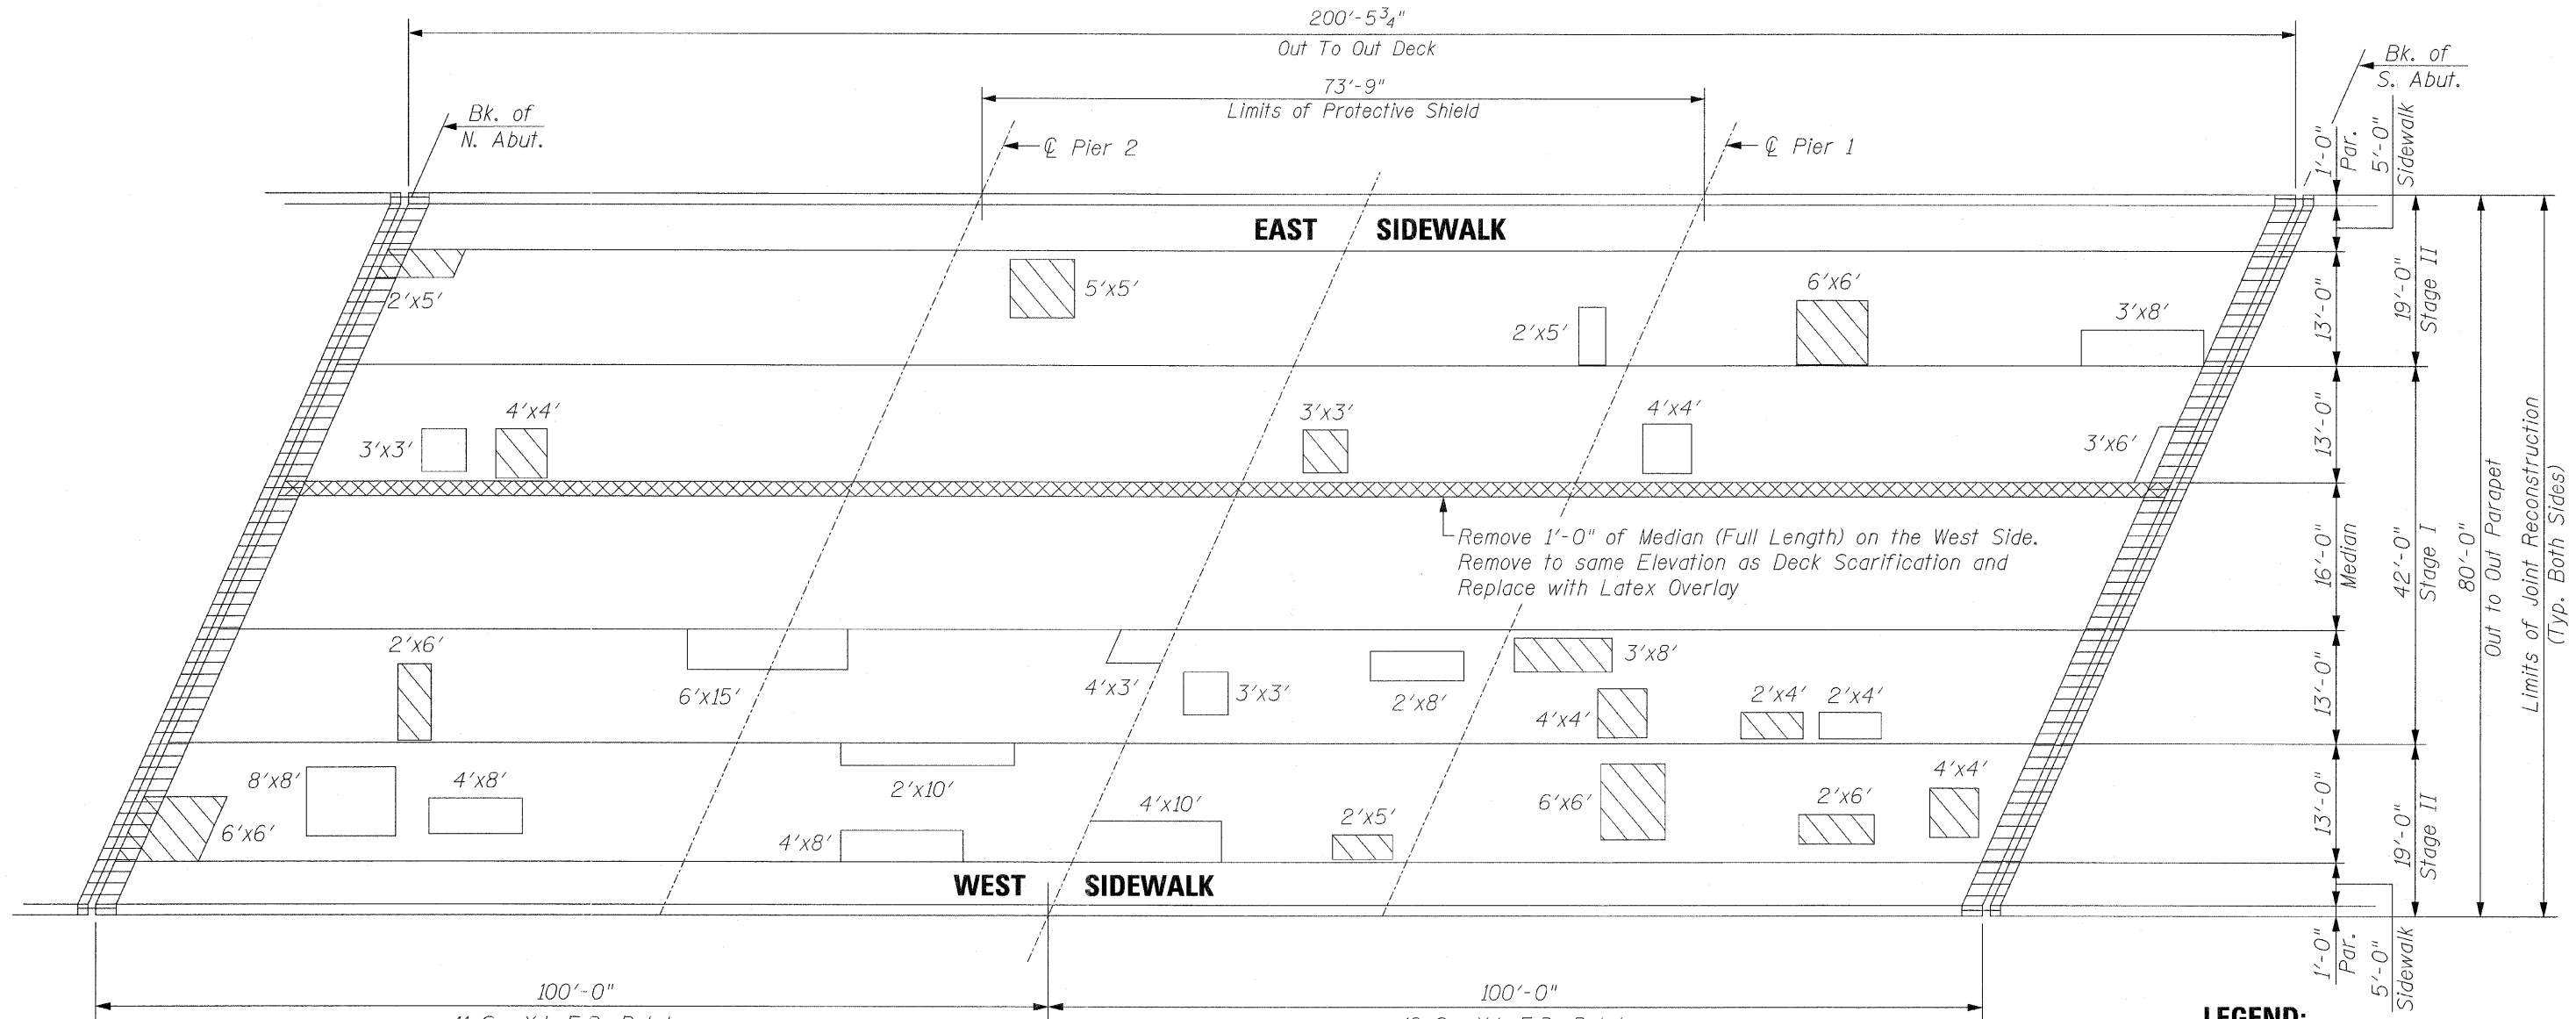

11 Sq. Yd. F.D. Patch
* 29 Sq. Yd. P.D. Patch

19 Sq. Yd. F.D. Patch
* 16 Sq. Yd. P.D. Patch

SIDEWALK REPAIR

LOCATION	UNIT	QUANTITY
EAST SIDEWALK	SQ. FT.	(164x2) = 328.0
WEST SIDEWALK	SQ. FT.	(164x2) = 328.0

**STRUCTURAL REPAIR OF CONCRETE
(DEPTH EQUAL TO OR LESS THAN 5 IN.)
= 656.0 SQ. FT.**

**THE ACTUAL LOCATIONS OF SIDEWALK REPAIR WILL BE
DETERMINED BY THE ENGINEER AT THE TIME OF CONSTRUCTION.**

* **DECK SLAB PARTIAL DEPTH
REPAIR PATCHES ARE SHOWN
FOR INFORMATION ONLY**

BILL OF MATERIAL

DESCRIPTION	UNIT	QUANTITY
CONCRETE REMOVAL	CU. YD.	5.5

- LEGEND:**
- F.D. = FULL DEPTH
 - * P.D. = PARTIAL DEPTH
 - CONCRETE REMOVAL

REVISIONS	
NAME	DATE

ILLINOIS DEPARTMENT OF TRANSPORTATION
DECK CONCRETE PATCHING
IL. RTE. 59
OVER
UNION PACIFIC R.R.
F.A.P. RTE. 338 SECTION: 2007-024 I
DuPAGE COUNTY
STRUCTURE NO. 022-0143
SCALE: NONE DATE: JANUARY 12, 2007 DRAWN BY: D.L./F.M.
CHECKED BY: B.N.S./S.J.P.
CHRISTIAN-ROGE & ASSOC., INC.
CHICAGO ILLINOIS