
STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION


Various Routes
OVD SIN STR REP & REPL 2005-12
Various Counties
Sheet 27 of 82
Contract Number 44872

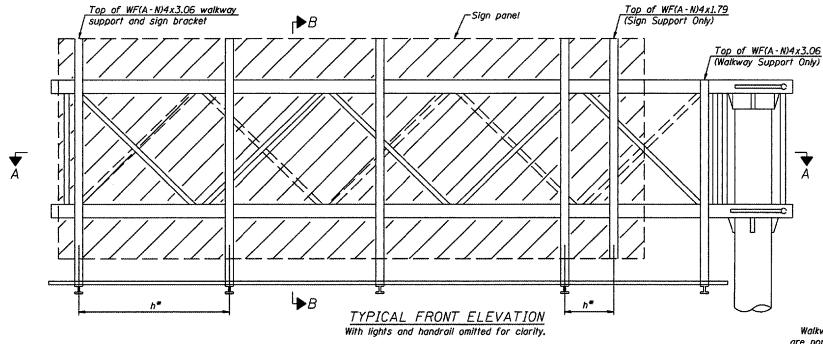

WGL ED L

Walkway and truss grating dimensions are nominal and may vary (width $\pm l_2$ ", depth $\pm l_2$ ") based on available standard widths

PLAN
WALKWAY AND HANDRAIL SKETCH
(Road plan beneath truss varies)

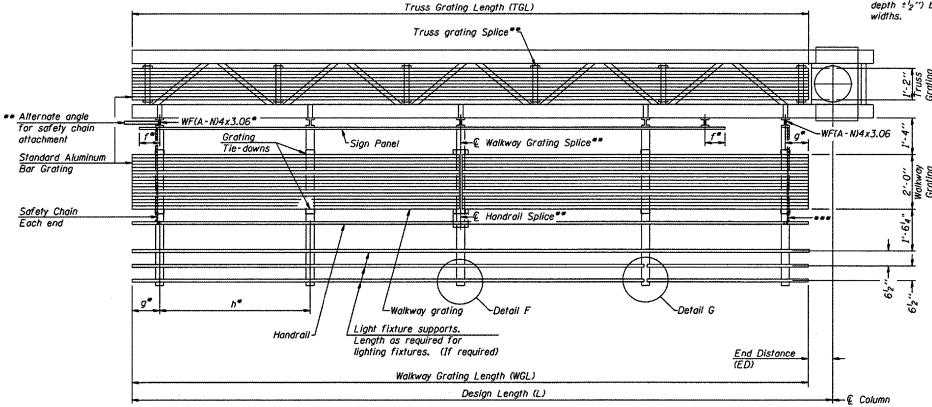

Structure Number	Station	WGL	ED	TGL
2C081S092L029.5	332 + 50	*		23' - 8"
2C081S092L028.8	369 + 75			23' - 8"
2C08JS092L029.4	342 + 50	*		23' - 8"
2C08IS092R028.6	383 + 00	#		23' - 8"

Notes:

- Space walkway brackets WF(A-N)4x3.06 and sign brackets WF(A-N)4x1.79 for efficiency and within limits shown:
- f = 12" maximum, 4" minimum (End of sign to € of nearest bracket)
- g = 12" maximum, 4" minimum (End of walkway to & of nearest bracket)
- h = 6'-0" maximum (C to C sign and/or walkway support brackets, WF(A-N)4x1.79 or WF(A-N)4x3.06)
- *** If walkway bracket at safety chain location is behind sign, add angle to bracket.

For details of sign placement, sign/walkway brackets, truss and walkway gratings, grating splices and Section B-B, see Base Sheet OSC-A-7.

For details of handrail, handrail splice, safety chain and Details F and G, see Base Sheet OSC-A-8.

SECTION A-A

Truss grating to facilitate inspection shall run full length of cantilevers. Cost of truss grating is included in Overhead Sign Structure Cantilever.

 $TGL = L - (\frac{Post \ O.D.}{2} + 6")$

				4-
[NUMBER	REVISION	
DESIGNED -	- 20			
CHECKED -	EXAMINED			
	EMDINEER OF BRIDGE DESIGN PASSED			
DRAWN -	ENGINEER OF BRIDGES AND STRUCTURES			
CHECKED -			······································	
OSC-A-6	1-7-05	L	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	

BRACKET TABLE

,,	.79 or WF(A-N)- 308, Alloy 6061		
Sign Width		Number	
Greater Than	Less Than or Equal To	Brackets Required	
· · · · · ·	8'-0"	2	
8'-0"	14'-0"	3	
14'-0''	20'-0"	4	
20'-0''	26'-0"	5	
26'-0"	32'-0"	6	

CANTILEVER SIGN STRUCTURES
ALUMINUM WALKWAY DETAILS
ALUMINUM TRUSS & STEEL POST

District 2 Truss Repair & Replacement