



STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

ROUTE NO.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.	SHEET NO. 2
57	(46-JHB, HBK1)	Kankakee	9	7	2 SHEETS
FED. ROAD DIST. NO. 7	ILLINOIS	FED. AID PROJECT	Contract Number: 66699		

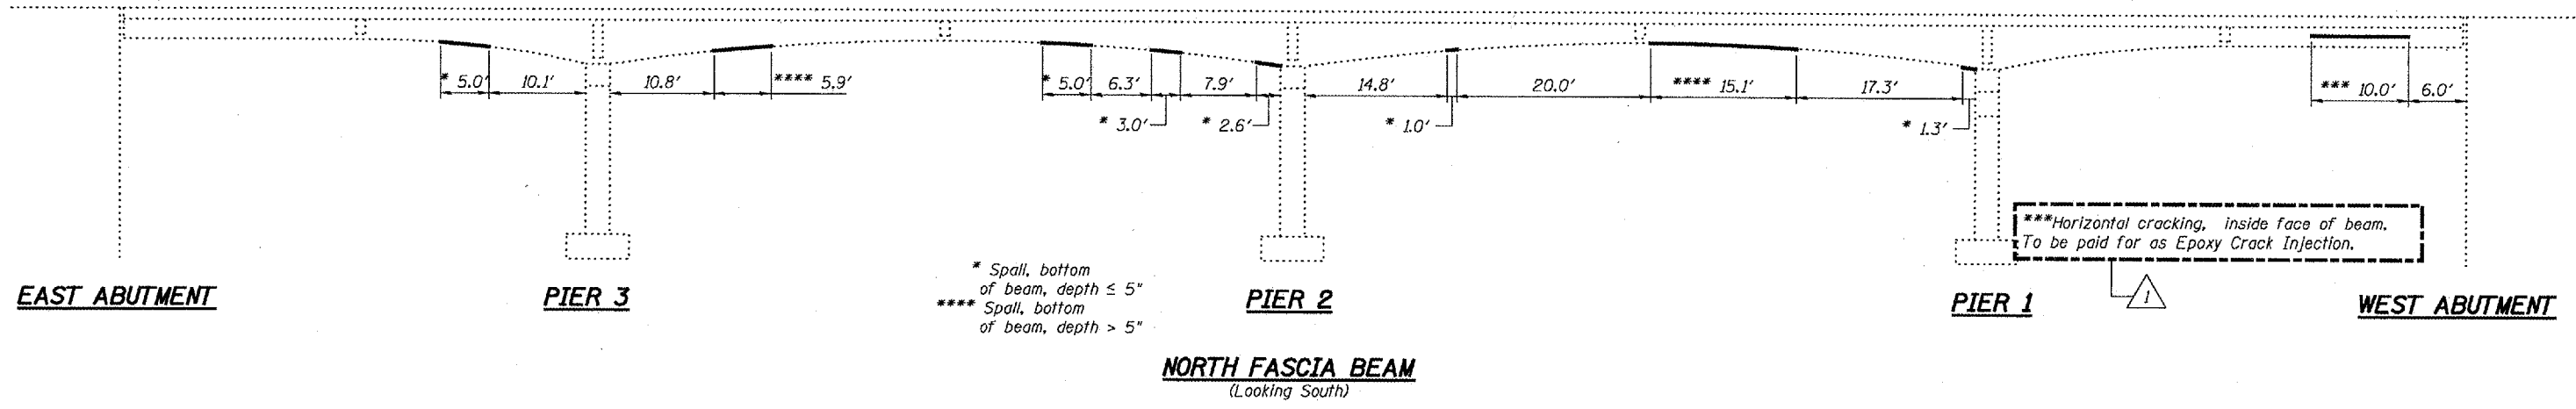

Notes:
Controlled Low-Strength Material shall be used to fill void between slab and slopewall at the East abutment. Concrete repair at bottom flanges of girder shall be repaired according to structural repair of concrete.

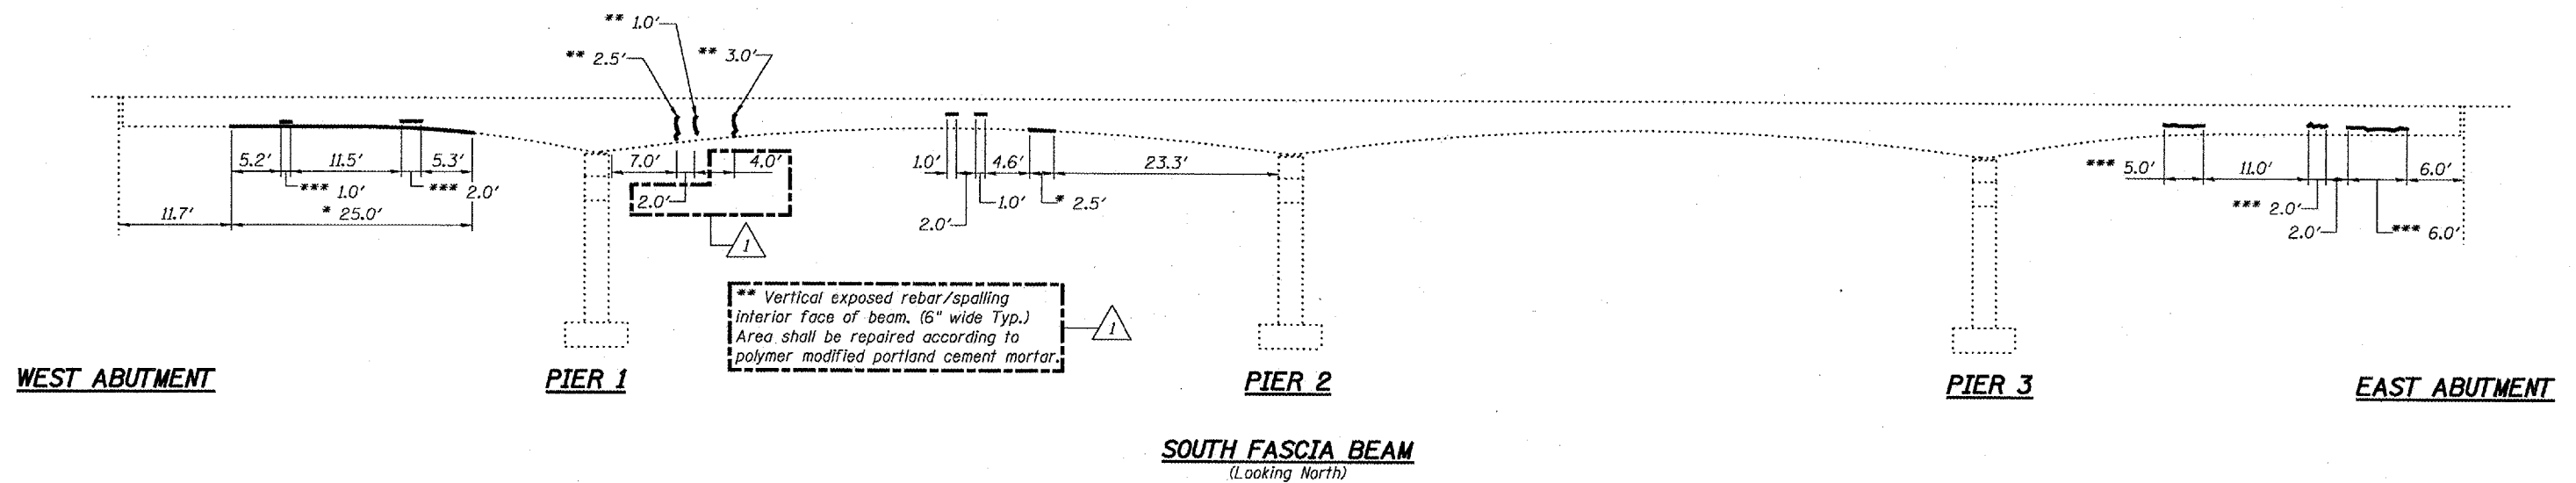

BILL OF MATERIAL

ITEM	UNIT	QUANTITY
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	78
Structural Repair of Concrete (Depth Greater Than 5")	Sq. Ft.	36
Epoxy Crack Injection	Foot	26
Controlled Low-Strength Material	Cu. Yd.	0.3
Polymer Modified Portland Cement Mortar	Sq. Ft.	3.3

DESIGNED S.J.B.
CHECKED A.T.H.
DRAWN Drew Christopher
CHECKED S.J.B. A.T.H.

May 9, 2007
EXAMINED *Carl Hoover*
PASSED *Ralph E. Anderson*
REPAIR PLANS UNIT CHIEF
ENGINEER OF BRIDGES AND STRUCTURES

REPAIR AREAS
F.A.I. RT. 57
KANKAKEE COUNTY
SN 046-0058