



PIER ELEVATION
South Face Looking North

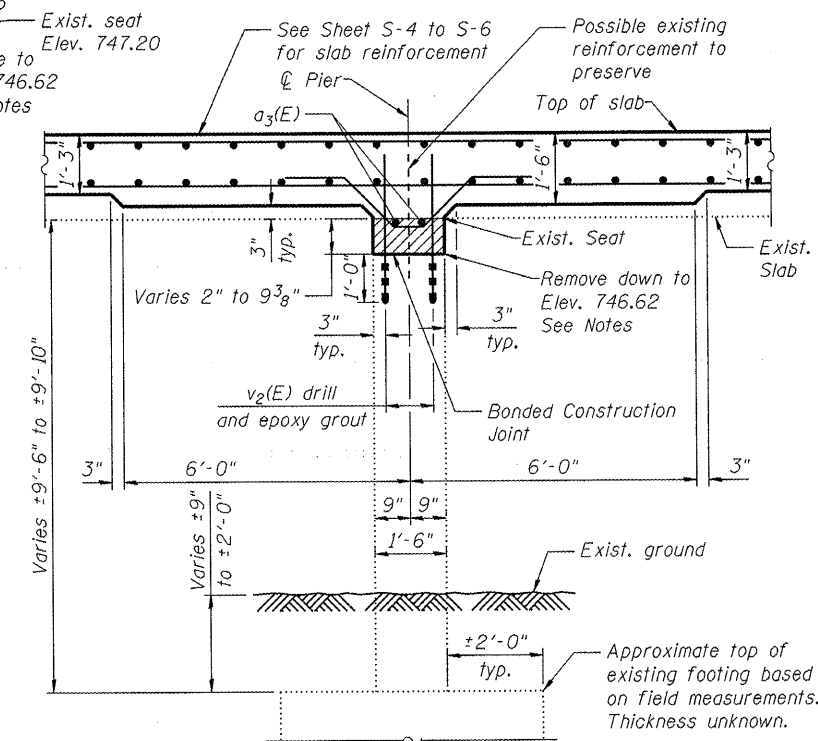

SECTION THRU PIER
Horizontal dimensions at Rt. L's

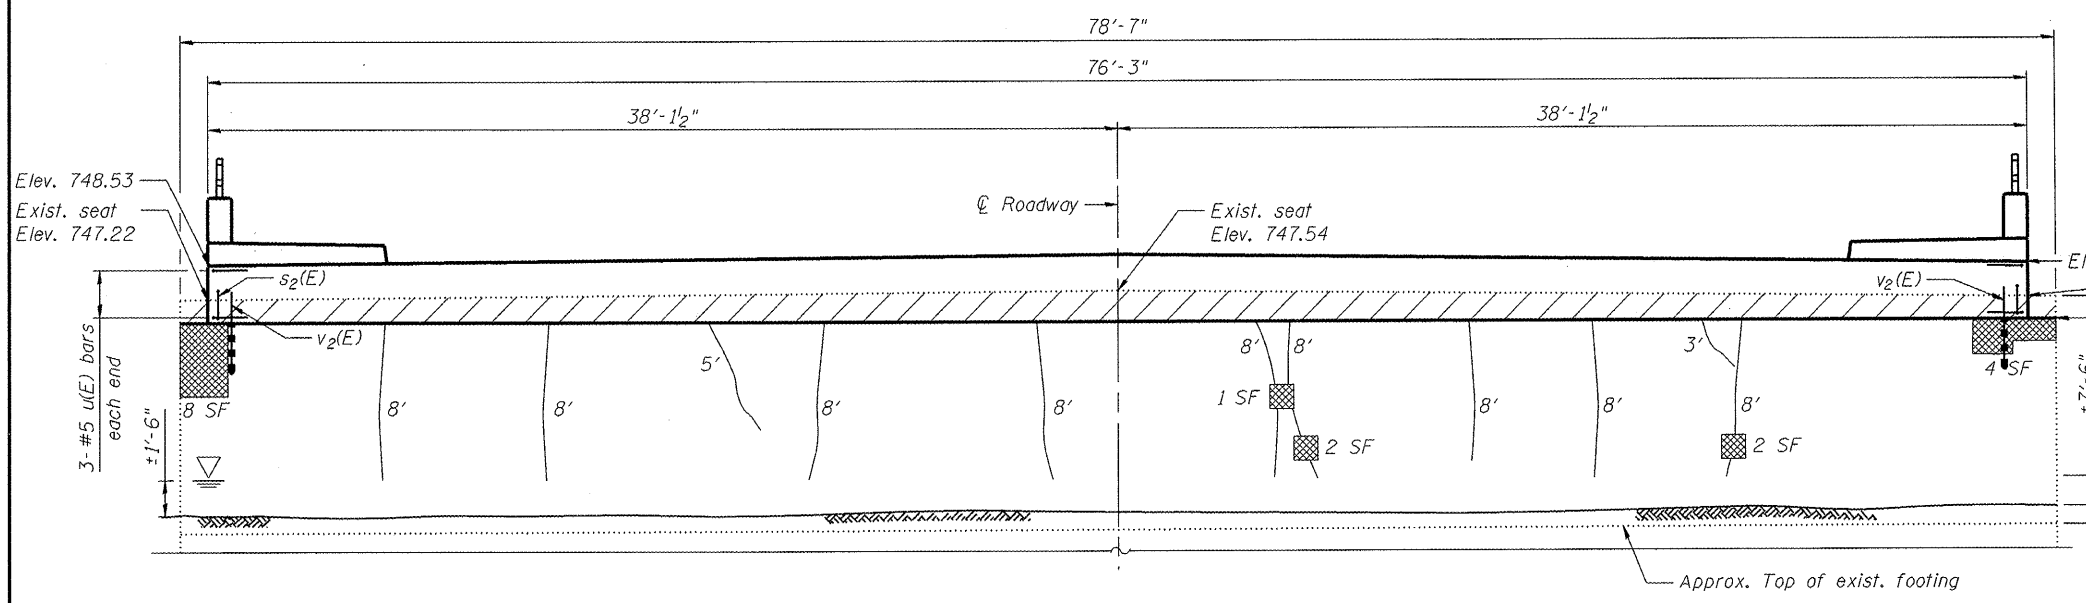

PIER ELEVATION
North Face Looking South

LEGEND

- Indicates Removal Item (See Notes)
- Indicates Structural Repair of Concrete (Depth less than or Equal to 5")
- Indicates Epoxy Crack Injection

Notes:
Existing reinforcement shall be cleaned and incorporated into the new construction. Cost included with Removal of Existing Superstructures.

Concrete removal at pier shall be in accordance with Section 501 of the Standard Specifications. Cost included in Removal of Existing Superstructures.

See Sheet S-6 for superstructure Bill of Materials. Drilling and epoxy grouting bars shall be in accordance with Section 584 of the Standard specifications. The cost for drilling and epoxy grouting bars shall be included in Reinforcement Bars, Epoxy Coated.

COMPANY NAME: HRGreen
 PROJECT CONTACT: HRGreen
 CLIENT: ILL. DOT
 FILE NAME: 10-00573-00-BR-001-PIER-01.dwg
 PLOT DRIVER: pldrvr
 PLOT TABLE: STRUCT_22x34.tbl



USER NAME = Karft	DESIGNED - KMA	REVISED -
	CHECKED - RGD	REVISED -
PLOT SCALE = N.T.S.	DRAWN - WJH	REVISED -
PLOT DATE = 3/31/2011	CHECKED - 3/31/11	REVISED -

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

PIER DETAILS
FAIRVIEW BOULEVARD - S.N. 101-6060

SHEET NO. S-11 OF S-11 SHEETS

F.A. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
5141	10-00573-00-BR	WINNEBAGO	20	19
CONTRACT NO. 85540			ILLINOIS FED. AID PROJECT	