



PRINT DATE: 6/11/2014 2:30:19 PM Y:\2042 I-64 Bridge Repair\DCN\Bridge\Final\Plotsheets\095-0043_0044\0950043-00000-003-JT_Details.dgn

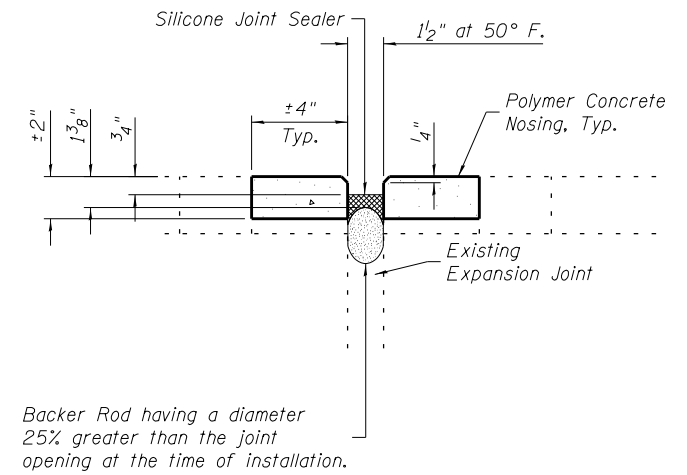

SECTION A-A
SILICONE JOINT SEALER DETAIL

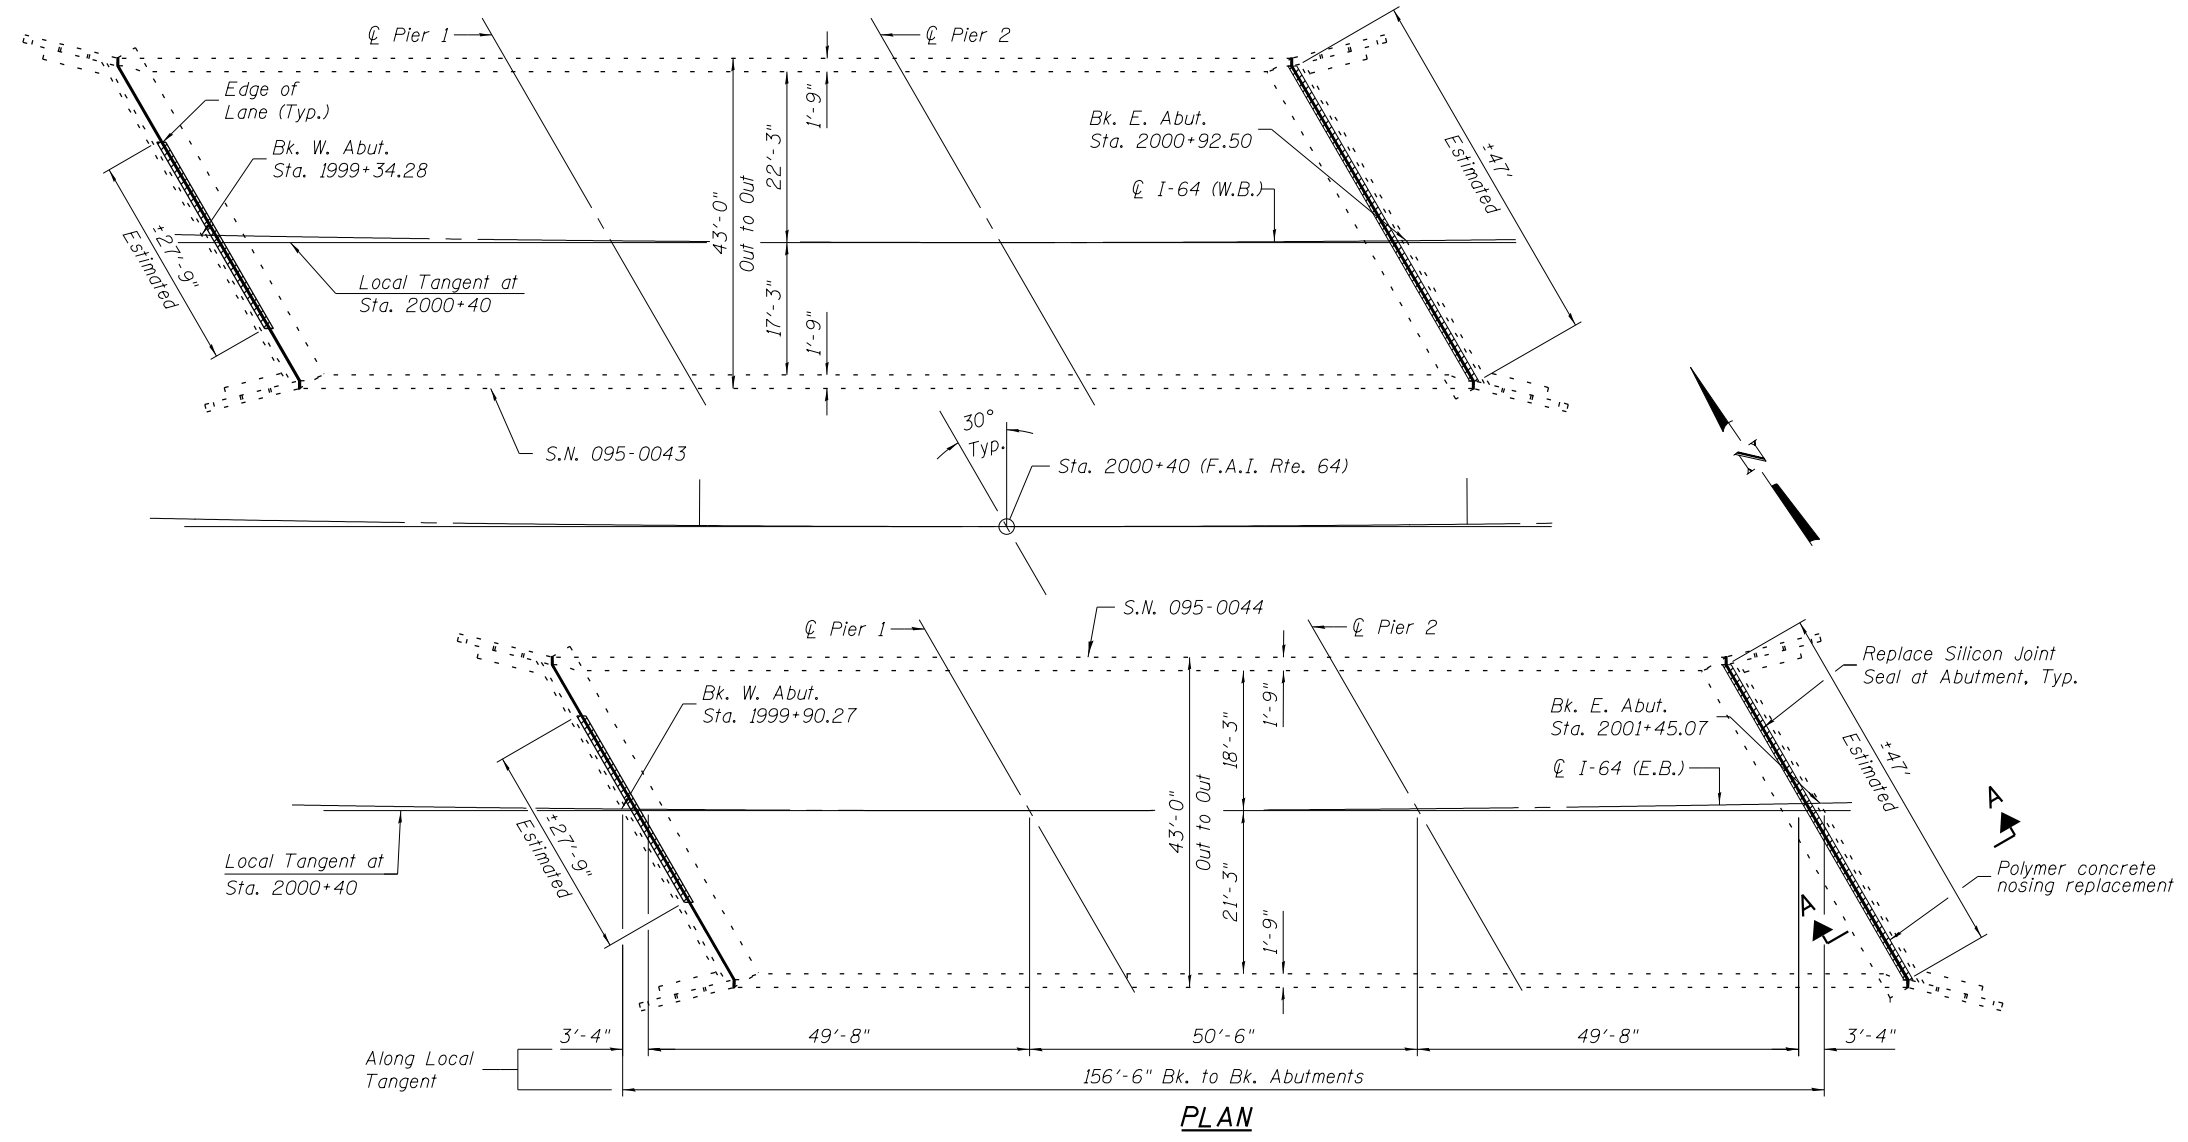

PLAN

Polymer Concrete Nosing Repair

Areas of Joint nosing repair shown are estimated, the Engineer shall show actual patch locations on as-built plans.

BILL OF MATERIAL

Item	Unit	Total
Silicone Joint Sealer, 1.5"	Foot	197.5
Polymer Concrete	Cu. Ft.	17

EFK Moen, LLC
Civil Engineering Design
303 Fountains Parkway, Suite 240
Fairview Heights, IL 62208
Phone 618-206-4250

USER NAME = cdl	DESIGNED - CDL	REVISED -
	CHECKED - CTW	REVISED -
PLOT SCALE = 0.2" = 1' / in.	DRAWN - JA	REVISED -
PLOT DATE = 6/11/2014	DATE - 6/11/2014	REVISED -

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

JOINT REPAIR DETAILS
STRUCTURE NO. 095-0043 & 095-0044

SHEET NO. 3 OF 7 SHEETS

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
64	95-1,21RS-1	WASHINGTON	126	111
CONTRACT NO. 76D20				
ILLINOIS FED. AID PROJECT				