


RECONSTRUCTION OF NORTH ABUTMENT JOINT STA. 657+94.64
STRUCTURE NUMBER 058-0049

ROUTE NO.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
VARIOUS	*	MACON	26	23

* DISTRICT 5 BRIDGE DECK REPAIR 1984-2

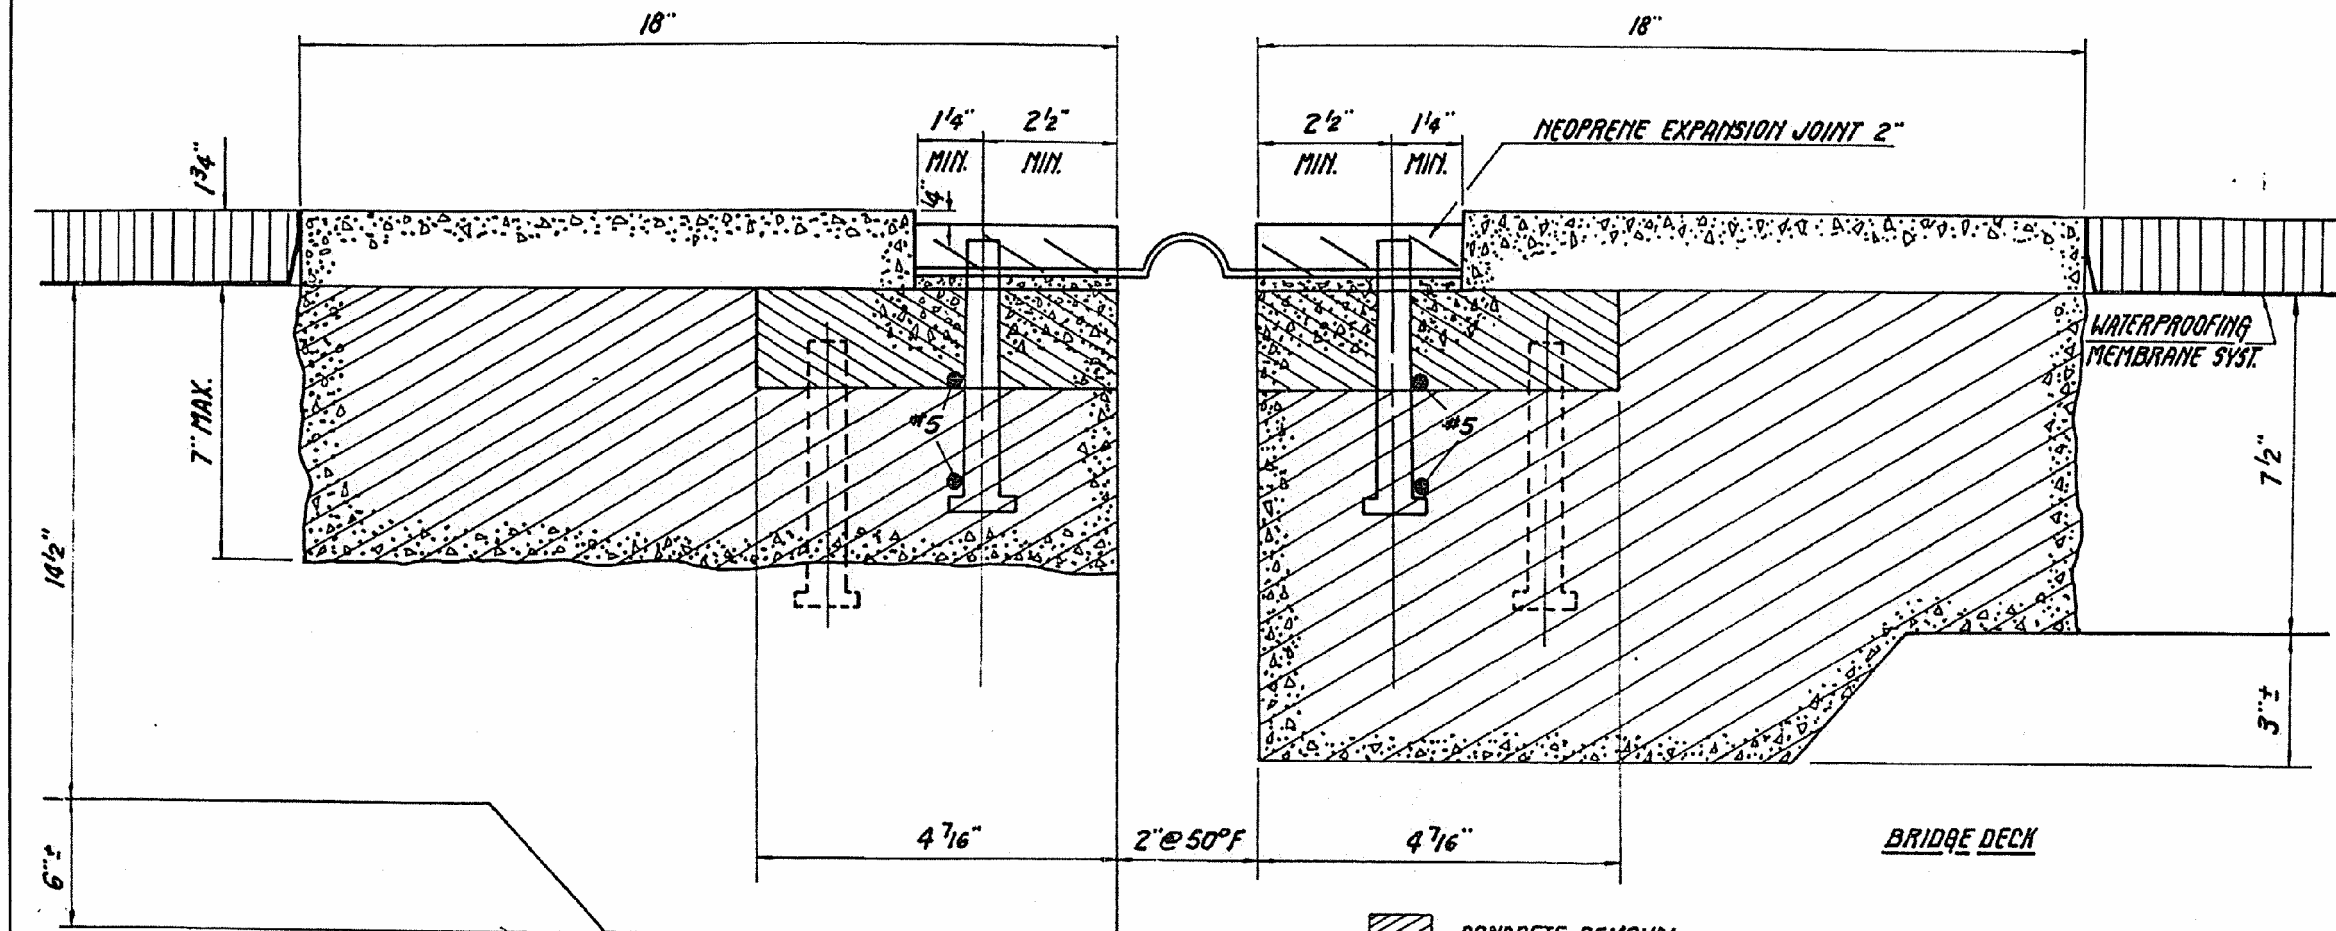

APPROACH SPAN

ANCHOR BOLTS (1/2" φ) SHALL BE CAST IN PLACE AND ARE TO BE CONSIDERED AS INCIDENTAL TO NEOPRENE EXPANSION JOINT 2". TWO #5 REINFORCEMENT BARS ARE TO BE PLACED WITH ANCHOR BOLTS EACH SIDE OF JOINT.

- CONCRETE REMOVAL
- EXISTING JOINT MATERIAL TO BE REMOVED
- PROPOSED CLASS X CONCRETE
- 1 3/4" BITUMINOUS CONCRETE SURFACE COURSE MIXTURE D, CLASS I

DRAWN BY	T.G.D. 5-10-84
CHECKED BY	A.E.H. 5-84

BLANK, WESSELINK, COOK & ASSOCIATES DECATUR, ILLINOIS ENGINEERS - CONSULTANTS DESIGN FIRM NO. 184000894

FILE NAME :	USER NAME :	DESIGNED	PBB	REVISED	-
		CHECKED		REVISED	-
	PLOT SCALE :	DRAWN	MLO	REVISED	-
	PLOT DATE :	CHECKED		REVISED	-

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

EXISTING BRIDGE PLANS

SHEET NO. 39 OF 39 SHEETS

F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
710	(48X-B-2)BR & (48BR)BR	MACON	144	77
CONTRACT NO. 74438				
ILLINOIS FED. AID PROJECT				