


Point Number	Tie to point	Tie Distance (feet)
1	T1 T2 T3	
2	T1 T2 T3	
3	T1 T2 T3	
4	T1 T2 T3	
5	T1 T2 T3	
6	T1 T2 T3	

LEGEND

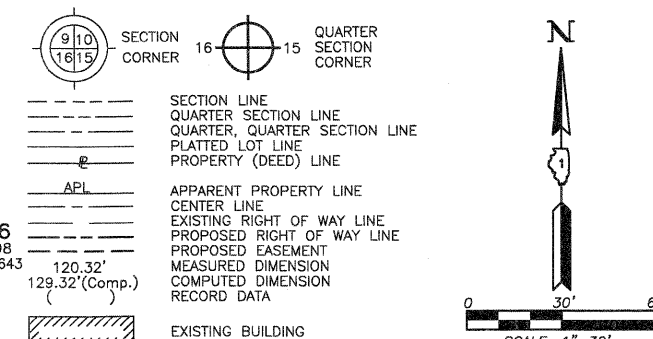

Bearings and Coordinates are referenced to the Illinois Coordinate System NAD 83(2007) East Zone.

- IRON PIPE OR ROD FOUND
- ⊕ "MAG" NAIL SET
- + CUT CROSS FOUND OR SET
- 5/8" REBAR SET
- T1 THESE STAKES REFERENCE FOUND OR SET MONUMENTATION. SET 5/8 INCH IRON ROD FLUSH WITH GROUND TO THE FOUND IRON STAKE. IDENTIFIED BY COLORED PLASTIC CAP BEARING SURVEYORS REGISTRATION NUMBER.
- T2
- T3
- BT1 THESE STAKES, IN CULTIVATED AREAS, REFERENCE FOUND OR SET MONUMENTATION. BURIED 5/8 INCH IRON ROD 20 INCHES BELOW GROUND TO THE FOUND IRON STAKE. IDENTIFIED BY COLORED PLASTIC CAP BEARING SURVEYORS REGISTRATION NUMBER.
- BT2
- BT3
- STAKING OF PROPOSED RIGHT OF WAY. SET DIVISION OF HIGHWAYS SURVEY MARKER TO MONUMENT THE POSITION SHOWN. IDENTIFIED BY INSCRIPTION DATA AND SURVEYORS REGISTRATION NUMBER.
- M STAKING OF PROPOSED RIGHT OF WAY IN CULTIVATED AREAS. BURIED 5/8 INCH METAL ROD 20 INCHES BELOW GROUND TO MARK FUTURE SURVEY MARKER POSITION IDENTIFIED BY COLORED PLASTIC CAP BEARING SURVEYORS REGISTRATION NUMBER.
- PERMANENT SURVEY MARKER, I.D.O.T STD 2135 (TO BE SET BY OTHERS)
- RIGHT OF WAY STAKING PROPOSED TO BE SET.

STATE OF ILLINOIS)
 COUNTY OF LAKE) SS
 THIS IS TO CERTIFY THAT WE, JORGENSEN & ASSOCIATES, INC., AN ILLINOIS PROFESSIONAL DESIGN FIRM LAND SURVEYING CORPORATION, NUMBER 184-2771, HAVE SURVEYED THE PLAT OF HIGHWAYS SHOWN HEREON IN SECTION 18, TOWNSHIP 43N., RANGE 8E., OF THE THIRD PRINCIPAL MERIDIAN, McHENRY COUNTY, THAT THE SURVEY IS TRUE AND COMPLETE AS SHOWN TO THE BEST OF MY KNOWLEDGE AND BELIEF THAT THE PLAT CORRECTLY REPRESENTS SAID SURVEY, THAT ALL MONUMENTS FOUND AND ESTABLISHED ARE OF PERMANENT QUALITY AND OCCUPY THE POSITIONS SHOWN THEREON AND THAT THE MONUMENTS ARE SUFFICIENT TO ENABLE THE SURVEY TO BE RETRACED. MADE FOR THE DEPARTMENT OF TRANSPORTATION, STATE OF ILLINOIS. DATED AT LAKE VILLA, ILLINOIS THIS _____ DAY OF _____ 20__ A.D.

JORGENSEN & ASSOCIATES, INC. PRESIDENT
 120 PARK AVENUE
 LAKE VILLA, ILLINOIS 60046
 (847) 356-3371
 SHEET 1 IS A COVER SHEET AND IS NOT RECORDED.

STATION	OFFSET	NORTH	EAST
8+44.15	38.50' Lt.	2,017,152.194	982,233.335
9+24.15	38.58' Lt.	2,017,151.942	982,313.334
9+24.15	43.58' Lt.	2,017,156.942	982,313.350
10+34.14	43.70' Lt.	2,017,156.594	982,423.338
10+34.15	38.70' Lt.	2,017,151.594	982,423.334
10+34.17	33.70' Lt.	2,017,146.594	982,423.329
10+34.48	41.30' Rt.	2,017,071.594	982,423.324

STATION	OFFSET	NORTH	EAST
14+61.92	34.16' Lt.	2,017,145.242	982,851.077
14+63.55	40.84' Rt.	2,017,070.237	982,852.385
14+71.29	44.17' Lt.	2,017,155.212	982,860.493
14+72.88	75.52' Lt.	2,017,186.550	982,862.213
14+81.22	106.24' Lt.	2,017,217.241	982,870.687
14+86.58	59.06' Lt.	2,017,170.040	982,875.837
14+87.09	40.81' Rt.	2,017,070.163	982,875.929
14+87.12	64.41' Rt.	2,017,046.568	982,875.855
15+47.10	45.75' Rt.	2,017,064.973	982,935.913
15+71.92	34.28' Lt.	2,017,144.894	982,961.077

See Sheet 25 for Total Holdings Parcel 1H40005

SKYRIDGE CLUB DEVELOPMENT
 Recorded May 29, 1987
 as Document No. 986817

Parcel	Document No.	Date Recorded
1H40005	986817	May 29, 1987
1H40006	89R035570	October 20, 1989
1H40007	516655	October 31, 1969
1H40007	97R049256	October 7, 1997
----	986817	May 29, 1987
----	89R035570	October 20, 1989
----	97R049256	October 7, 1997

CRYSTAL IN THE PARK SUBDIVISION UNIT ONE
 Recorded September 2, 1987
 as Document No. 87R000690
 Corrected by Certificates of Correction
 Recorded December 30, 1987
 as Document Nos. 87R014794 & 87R014795,
 Recorded January 20, 1988
 as Document No. 88R001645,
 Recorded March 15, 1988
 as Document No. 88R006764,
 Recorded April 19, 1988
 as Document No. 88R010876 &
 Recorded May 13, 1988
 as Document No. 88R013562

PARCEL NUMBER	OWNER	TOTAL HOLDINGS ACRES	PART TAKEN ACRES	SQUARE FEET	AREA IN EXISTING R.O.W. ACRES	REMAINDER AREA ACRES	EASEMENT AREA ACRES	EASEMENT PURPOSE	PERMANENT INDEX NUMBER	PROPERTY ACQUIRED BY
1H40005	Skyridge Partners, L.P., an Illinois Limited Partnership	9.245	0.006	278	N/A	9.239	N/A	N/A	19-18-426-001	
1H40006	James M. Elwart and Sherry J. Elwart, as Tenants by the Entirety	0.232	0.013	N/A	N/A	0.219	N/A	N/A	19-18-257-005	
1H40007	Windham Cove Condominium Association	2.259	0.112	N/A	N/A	2.147	N/A	N/A	19-18-279-001 through 19-18-279-009 19-18-279-016 through 19-18-279-019	