


**LEGEND**

-  Structural Repair of Concrete (Depth Equal to or Less than 5")
-  Structural Repair of Concrete (Depth Greater than 5")
-  Epoxy Crack Injection Repair

**STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION**


ROUTE NO. F.A.P. 368	SECTION 1919 VB-R-1	COUNTY Cook	SHEET NO. 47	SHEET TOTAL 37	SHEET NO. 28 28 SHEETS
FED. ROAD EST. NO. 7		ILLINOIS	FED. AID PROJECT		

Contract # 60C11

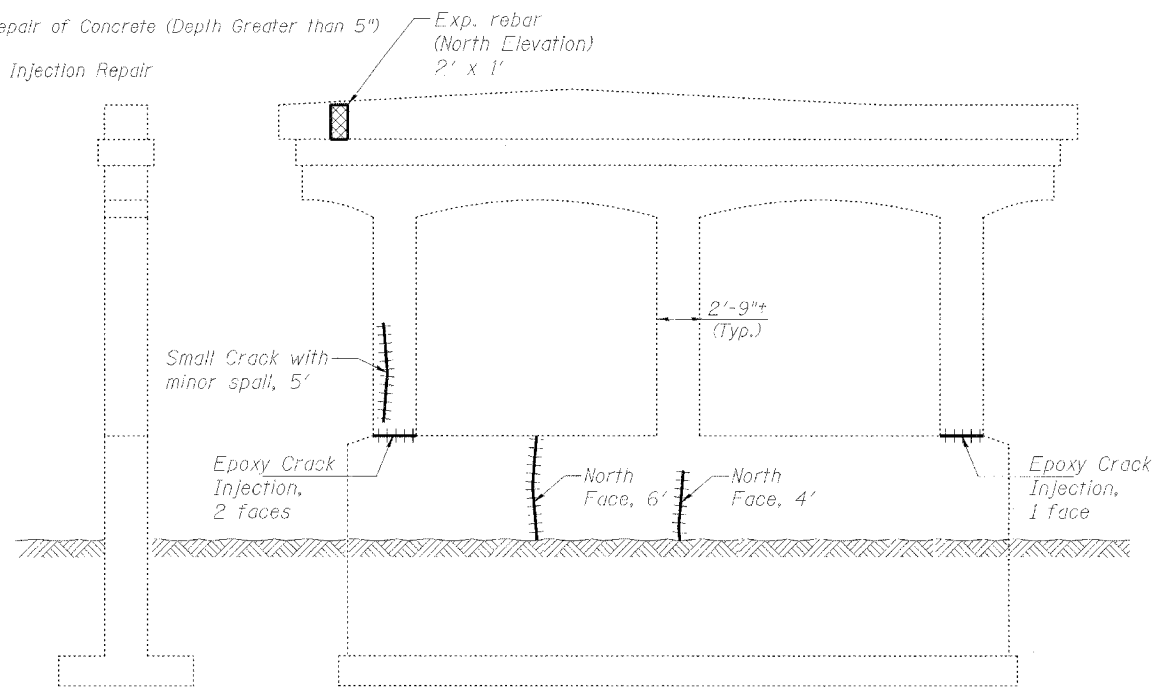

**PIER 4**


(Looking South - except as noted)

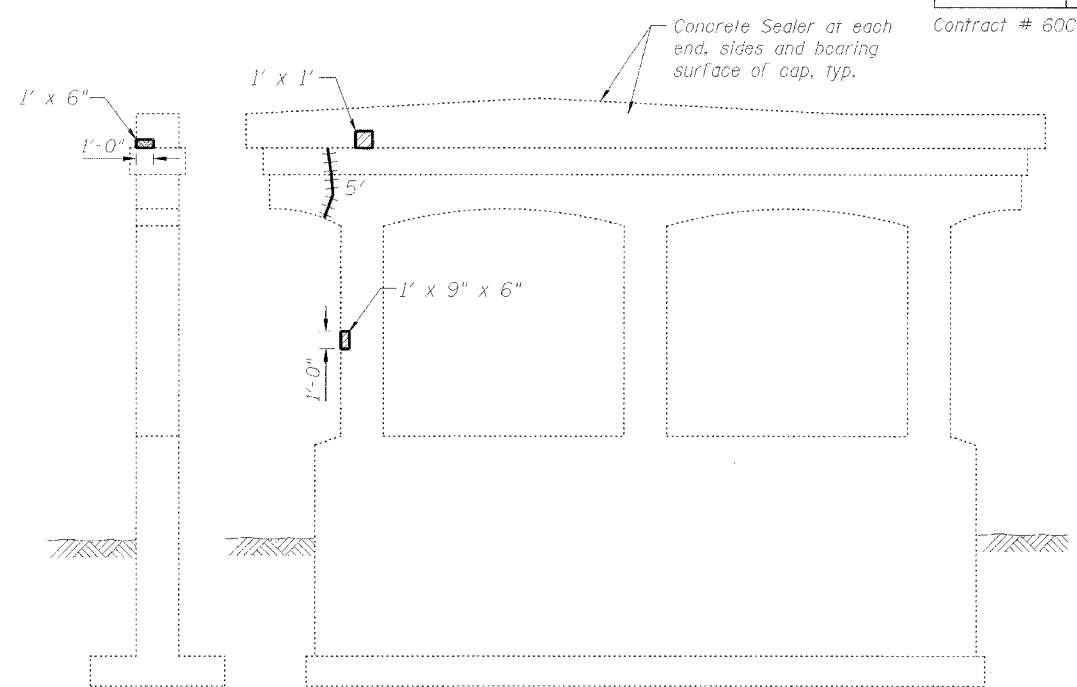

**EAST ELEVATION**


**PIER 6**

(Looking South)

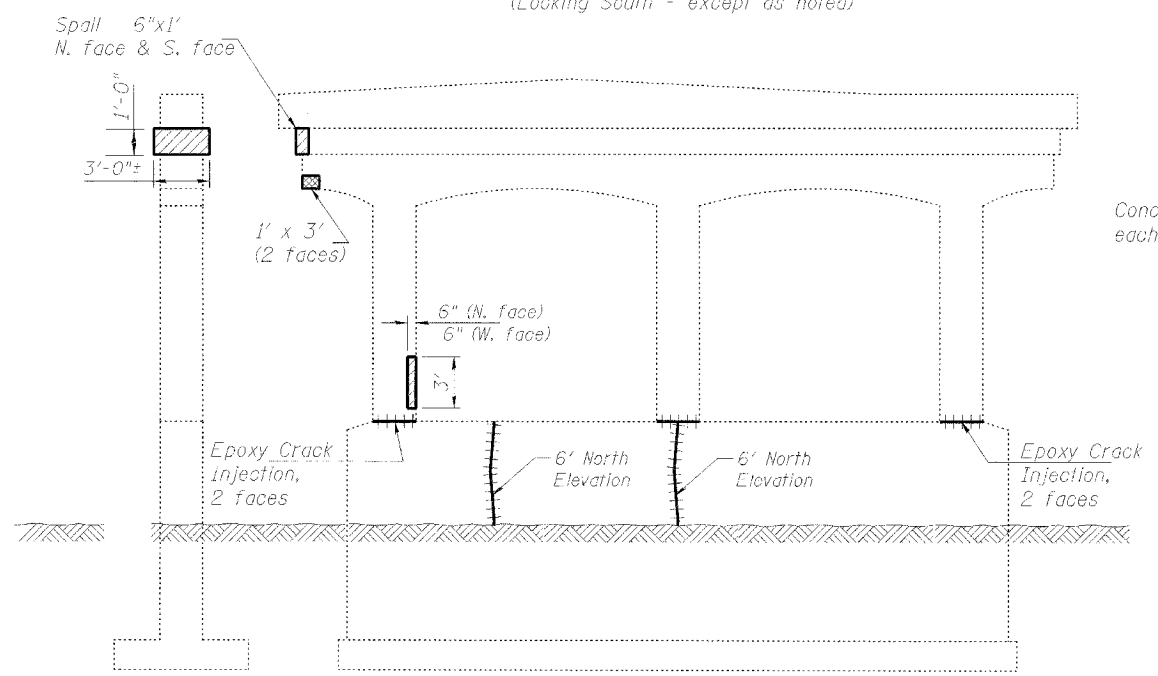

**PIER 5**

(Looking South - except as noted)

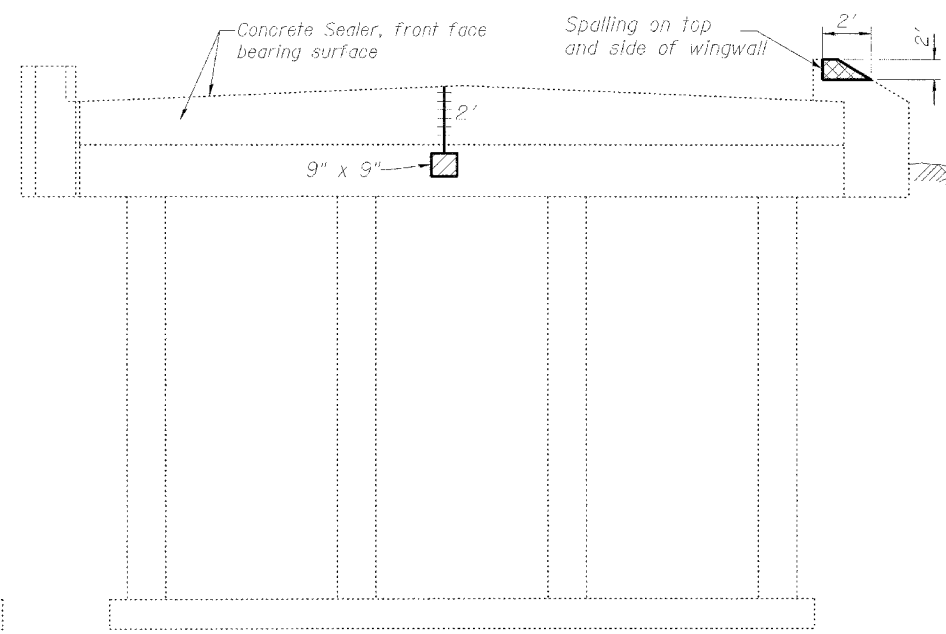

**NORTH ABUTMENT**


(Looking North)

**BILL OF MATERIAL - THIS SHEET**

Item	Unit	Quantity
Structural Repair of Concrete (Depth Greater Than 5")	Sq. Ft.	17
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	10
Epoxy Crack Injection	Foot	53
Concrete Sealer	Sq. Ft.	1,320

**SUBSTRUCTURE REPAIRS  
F.A.P. 368 (PULASKI ROAD)  
OVER BRC RAILROAD,  
SECTION 1919 VB-R-1,  
COOK COUNTY, STA. 17+81.60  
STRUCTURE NO. 016-1020**

DESIGNED DDB
CHECKED LLV
DRAWN MGM
CHECKED DDB



**STS Consultants**  
111 NE Jefferson Ave.  
Peoria, Illinois 61602  
Ph: (309) 676-8464  
FAX: (309) 676-5445  
IL Design Firm Reg. No. 184-001518