



### EASTBOUND ROADWAY, INSIDE ELEVATION OF SOUTH PARAPET

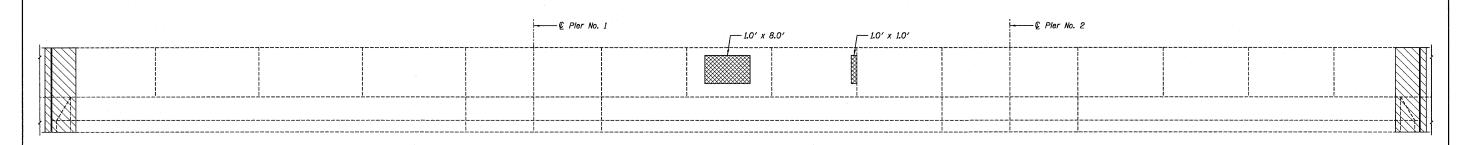

### WESTBOUND ROADWAY, INSIDE ELEVATION OF NORTH PARAPET

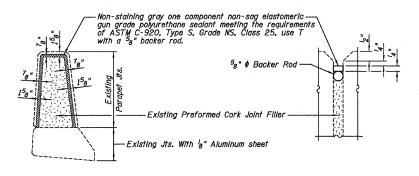

# PARAPET JOINT DETAILS (15 joints per parapet)

## BILL OF MATERIAL

ITEM	UNIT	082-0167	082-0168	TOTAL
Protective Coat	Sq. Yd.	236	229	465
Structural Repair of Concrete (Depth Equal to or Less than 5 Inches)	Sq. Ft.	12	9	21
Joint Sealer	Foot	125	125	250

# <u>LEGEND</u>

Structural Repair of Concrete (Depth Equal to or Less than 5 Inches)

Concrete Removal for Expansion Joint Replacement, see Sheets A7 thru A10

## NOTE:

Elevations of Parapet Views are exaggerated vertically.

Farnsworth GROUP, INC.	DESIGNED - JCZ	REVISED	STATE OF ILLINOIS	PARAPET REPAIR	RTE. SECTION	COUNTY TOTAL SHEET
	CHECKED - JML	REVISED		STRUCTURE NO. 082-0167 (E.B.)	64 82-(3,4)F	RS ST. CLAIR 167 106
2709 McGraw Drive	DRAWN - DJM/JWK	REVISED	DEPARTMENT OF TRANSPORTATION	STRUCTURE NO. 082-0168 (W.B.)		CONTRACT NO. 76415
Bloomington, Illinois 61704 309/663-8435, 309/663-1571 fax D.	DATE - 12/05/11 CHECKED - MSW	REVISED	'	SHEET NO. A6 OF 21 SHEETS	ILL	INOIS FED. AID PROJECT
						24-8570