


PLAN SURVEYED BY DATE
 ALIGNED BY DATE
 CHECKED BY DATE
 NO. OF WAY CHECKED
 NO. ROAD FILE NAME

PROFILE SURVEYED BY DATE
 GRADES CHECKED BY DATE
 E.M. NOTED BY DATE
 STRUCTURE NOTATIONS CHRD

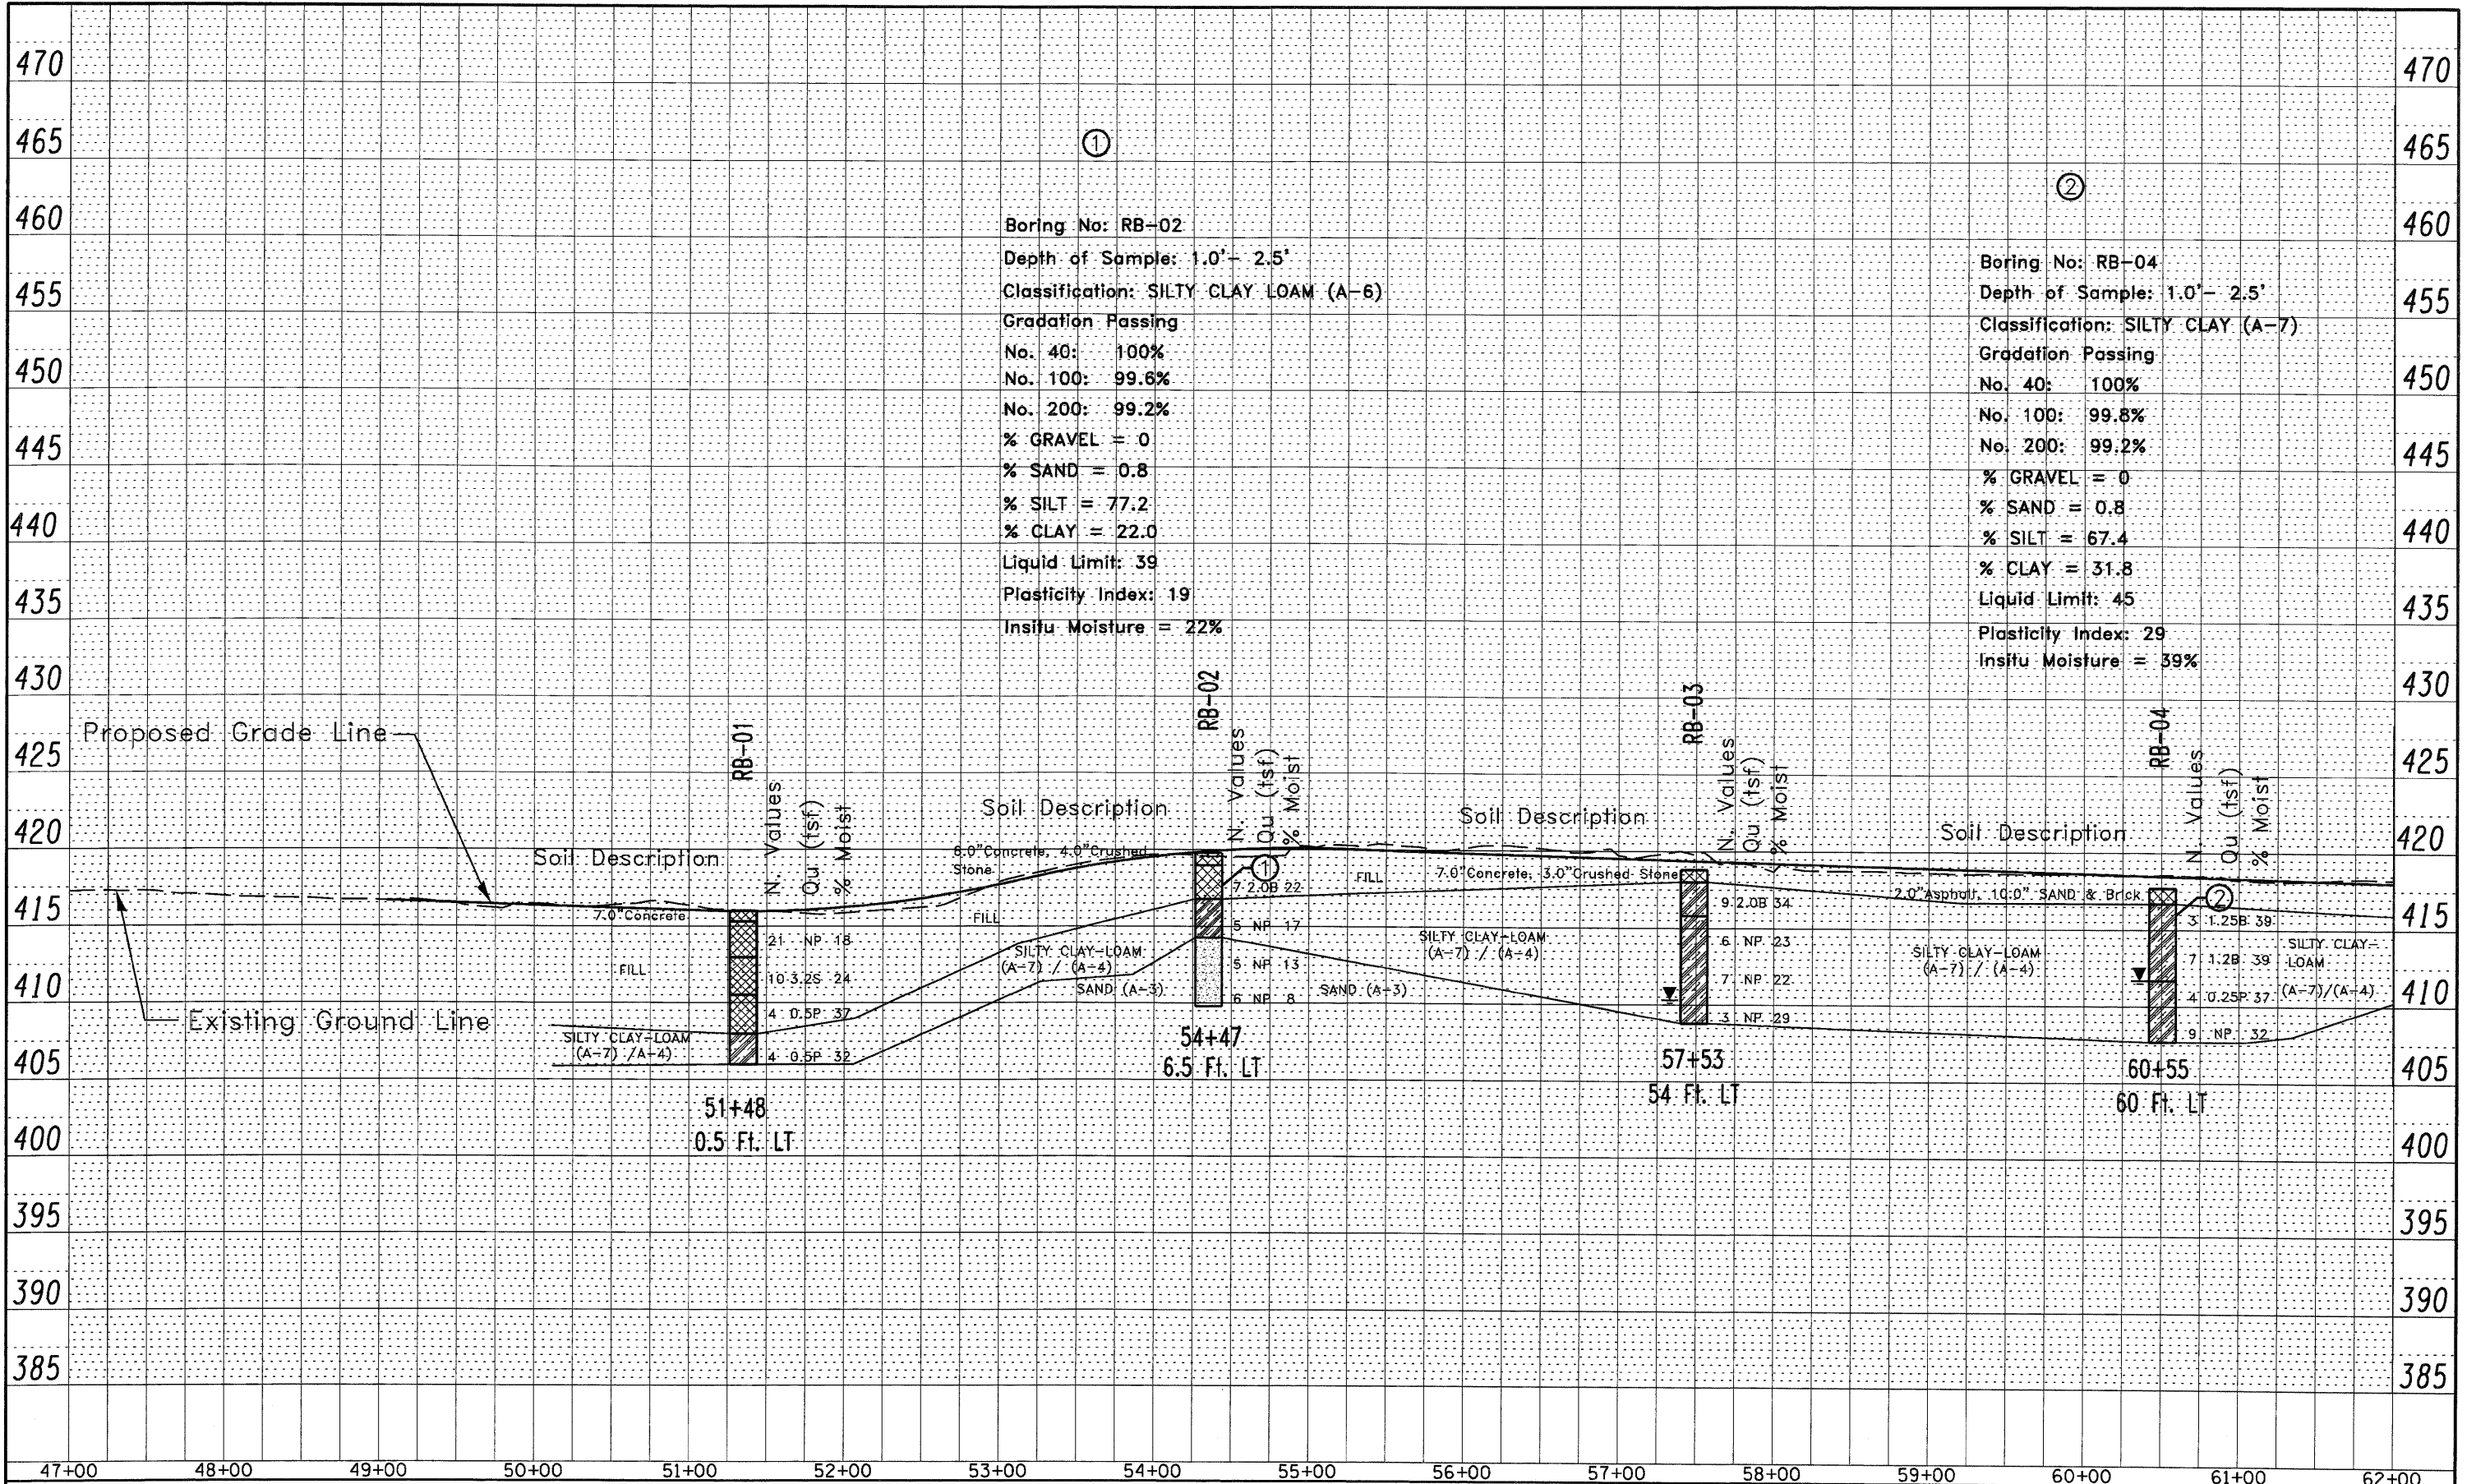

Boring No: RB-02
 Depth of Sample: 1.0' - 2.5'
 Classification: SILTY CLAY LOAM (A-6)
 Gradation Passing
 No. 40: 100%
 No. 100: 99.6%
 No. 200: 99.2%
 % GRAVEL = 0
 % SAND = 0.8
 % SILT = 77.2
 % CLAY = 22.0
 Liquid Limit: 39
 Plasticity Index: 19
 Insitu Moisture = 22%

Boring No: RB-04
 Depth of Sample: 1.0' - 2.5'
 Classification: SILTY CLAY (A-7)
 Gradation Passing
 No. 40: 100%
 No. 100: 99.8%
 No. 200: 99.2%
 % GRAVEL = 0
 % SAND = 0.8
 % SILT = 67.4
 % CLAY = 31.8
 Liquid Limit: 45
 Plasticity Index: 29
 Insitu Moisture = 39%