

Illinois Department of Transportation

Asbestos Abatement Survey

Work Order No.: 48

Job Order No.: R-97-004-20

Route: US 40, IL 33 (FAP 95)

Parcel No.: 7004124

201 E. Fayette Avenue

Effingham, Effingham County, IL 62401

January 21, 2026

Asbestos Abatement Survey

Work Order No.: 48
Job Order No.: R-97-004-20
Route: US 40, IL 33 (FAP 95)
Parcel No.: 7004124
201 E. Fayette Avenue
Effingham, Effingham County, IL 62401

January 21, 2026

Prepared By:

Arcadis U.S., Inc.
225 West Wacker Drive
Suite 2015
Chicago, Illinois 60606
Phone: 312 917 1000

Prepared For:

Illinois Department of Transportation
2300 South Dirksen Parkway
Springfield, IL 62764

Our Ref:


30296440



Anthony Spalla
Asbestos Inspector



Katherine Challberg
Senior Environmental Engineer / QA/QC

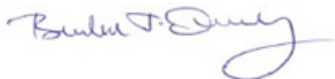

Brendan J. Quealy
Principal Environmental Engineer/Certified Project Manager

This document is intended only for the use of the individual or entity for which it was prepared and may contain information that is privileged, confidential and exempt from disclosure under applicable law. Any dissemination, distribution or copying of this document is strictly prohibited.

Contents

Acronyms and Abbreviations.....	ii
1 Introduction.....	1
2 Survey Methodology	1
3 Analytical Methods.....	2
4 Findings.....	2
5 Recommendations.....	2
6 Cost Estimate.....	3
7 Additional Survey Limitations.....	4

Tables

Table 1	Asbestos Homogeneous Areas Summary
---------	------------------------------------

Figures

Figures 1-4	Asbestos Bulk Sampling Locations
Figure 5	Asbestos-Containing Materials Locations

Appendices

Appendix A	Limitations and Service Constraints
Appendix B	Accreditations - Inspector, Laboratory
Appendix C	Laboratory Reports – Asbestos
Appendix D	Photograph Log

Acronyms and Abbreviations

ACM	asbestos-containing material
AHERA	Asbestos Hazard Emergency Response Act
Arcadis	Arcadis U.S., Inc.
ASTM	ASTM International
CFR	Code of Federal Regulations
COC	chain of custody
DS	dispersion staining
HA	homogeneous area
IAC	Illinois Administrative Code
IDPH	Illinois Department of Public Health
IDOT	Illinois Department of Transportation
IEPA	Illinois Environmental Protection Agency
NESHAP	National Emissions Standards for Hazardous Air Pollutant
NIOSH	National Institute for Occupational Safety and Health
NVLAP	National Voluntary Laboratory Accreditation Program
OSHA	Occupational Safety and Health Administration
PLM	polarized light microscopy
PPE	personal protective equipment
QA/QC	quality control/quality assurance
STAT	STAT Analysis Corporation of Chicago, Illinois
USEPA	United States Environmental Protection Agency

1 Introduction

Arcadis U.S., Inc. (Arcadis) conducted an asbestos abatement survey (survey) at Parcel No. 7004124 located at 201 E. Fayette, Effingham, Effingham County, Illinois (Site) in accordance with Work Order No. 48 under the Prime Agreement for Consulting Services for PTB No. 202-043 between Illinois Department of Transportation (IDOT) and Arcadis. Arcadis' services and report are subject to the Limitations and Service Constraints provided in **Appendix A**.

The Site is a one and one-half story two family residential building with a full basement (unfinished) and an enclosed sunroom, constructed in 1910, and covering approximately 2,123 square feet. A detached garage is also present and included in the scope of the work.

The objective of the survey was to ascertain the general presence, quantity, and location of asbestos-containing materials (ACMs) at the site that may be impacted by the planned demolition and provide preliminary cost estimates for asbestos abatement that may be required prior to demolition activities.

The survey activities were conducted on August 27, 2025, by Anthony Spalla of Arcadis U.S., Inc. and Patrick Hook of A3 Environmental LLC. (A3E), an Arcadis sub-consultant. Copies of their accreditations are provided in **Appendix B**.

2 Survey Methodology

Arcadis conducted the asbestos survey in compliance with the United States Environmental Protection Agency (USEPA) National Emissions Standards for Hazardous Air Pollutants (NESHAPs), applicable State of Illinois and local asbestos regulations. This was accomplished by conducting a visual inspection of the structures to be impacted by the planned demolition and collecting samples of suspect ACM based on these observations. Arcadis conducted the asbestos survey in general accordance with ASTM International (ASTM) E2356 Standard Practice for Comprehensive Building Asbestos Surveys. ASTM E2356 meets the applicable asbestos survey and/or sampling requirements of current USEPA NESHAP Standard [40 Code of Federal Regulations (CFR) 61, Subpart M (Asbestos)], USEPA Asbestos Hazard Emergency Response Act (AHERA) [40 CFR 763, Subpart E], and Occupational Safety and Health Administration (OSHA) Asbestos Construction Standard [29 CFR 1926.1101].

The survey included an inspection of the structures to be impacted by the planned demolition providing a general sense of the overall location, type, quantity, and condition of suspect ACMs present. The asbestos survey included a visual and physical assessment of each accessible space to locate suspect ACMs. Suspect materials were divided into "Homogeneous Areas" (HAs) (i.e., materials that were determined by the inspector to be homogeneous based on their color, texture, and assumed date of installation).

A representative number of samples were collected from each HA. Bulk material samples were collected in 4-milliliter plastic bags and tightly sealed for transport to STAT Analysis Corporation (STAT) in Chicago, Illinois. Each sample collected by Arcadis was assigned its own unique coded number and sent for laboratory analysis under a chain-of-custody (COC) protocol.

The survey included destructive, intrusive, and/or exploratory testing unless specifically prohibited by IDOT. Destructive sampling is performed in order to identify materials which are hidden or obstructed. Hidden or obstructed areas include but are not limited to wall cavities, pipe chases, spaces above fixed ceilings, materials located under carpeting or subfloors, and ceramic tile grout/adhesive.

3 Analytical Methods

Asbestos bulk samples were analyzed for asbestos (reported in percent of type of asbestos) using polarized light microscopy with dispersion staining (PLM/DS) in accordance with the USEPA Method 600/R-93/116. Percentage estimates of each material's composition are based on the analyst's best visual judgment following PLM/DS analysis, and examination with a stereoscope.

STAT is accredited under the National Voluntary Laboratory Accreditation Program (NVLAP). A copy of their accreditation is provided in **Appendix B**. Laboratory analytical reports are provided in **Appendix C**.

4 Findings

Arcadis identified 27 HAs from which 83 samples were collected and analyzed. A listing of the identified HAs, including each HA material description, location, sample number, condition, asbestos content, and estimated quantity, are presented in Table 1. Approximate sampling locations are shown on Figures 1-4 and locations of identified ACM are shown on Figure 5.

The USEPA defines ACM as a material containing greater than 1% asbestos. Materials containing less than 1% asbestos are not regulated by the USEPA or the State of Illinois, but their disturbance is regulated by OSHA.

The following HA has been confirmed to be ACM:

- HA-1: White Popcorn Ceiling in Bedroom 3 and Living Room 3

No HAs were identified as assumed ACM.

The remaining bulk samples collected by Arcadis as part of the survey were reported by the laboratory to be ND = Asbestos Not Detected (Not Present).

Representative photographs are provided in **Appendix D**.

5 Recommendations

ACMs identified at the site that may be disturbed during demolition activities, must be removed by a licensed asbestos abatement contractor utilizing industry standard work procedures in accordance with all federal, state, and local regulations governing asbestos.

If other suspect materials not referenced in this survey report are identified during demolition activities, we recommend these materials be assumed ACM until the materials are inspected by a licensed asbestos inspector, sampled, and submitted for laboratory analysis.

6 Cost Estimate

Arcadis prepared this rough order of magnitude (ROM) opinion of cost to support planned asbestos abatement activities at the Site prior to building demolition.

ROUGH ORDER OF MAGNITUDE OPINION OF ASBESTOS ABATEMENT COSTS		
ASBESTOS ABATEMENT COSTS		
Item	Estimated Cost	Estimated Duration (Days)
Removal/disposal of identified ACM	\$15,000.00	2
Removal/disposal of assumed ACM	N/A	N/A
Sub-Total Estimated Abatement Costs	\$15,000.00	2
Contingency (15%)	\$2,250.00	n/a
Total Estimated Abatement Costs	\$17,250.00	2
ASBESTOS OVERSIGHT COSTS		
Item	Estimated Cost	Estimated Duration (Days)
Project Management/Coordination/Reporting	\$2,000.00	n/a
ACM Abatement Oversight (including equipment and analysis)	\$3,000.00	2
Sub-Total Estimated Oversight Costs	\$5,000.00	2
Contingency (15%)	\$750.00	n/a
Total Estimated Oversight Costs	\$5,750.00	2
TOTAL ESTIMATED PROJECT COST (WITH 15% CONTINGENCY)	\$23,000.00	2

The above ROM opinion of cost is based on the following assumptions:

- Cost estimate is based on the information identified in Arcadis' survey report.
- Cost estimate includes permits, labor, equipment, waste transport and disposal.
- Cost estimate assumes work will be awarded in its entirety to one contractor and completed during a single mobilization.
- Cost estimate includes consulting fees such as project management, project oversight, air sampling, etc.
- Actual bids and schedule durations may vary.
- Oversight costs are dependent upon the project duration which may vary depending on the contractor's schedule and is outside of Arcadis' control.

7 Additional Survey Limitations

Arcadis' survey is subject to the following survey limitations.

- The investigation did not include access or inspection of confined spaces, underground piping, conduits, and building footings, if any.
- If other suspect materials, not referenced in this survey report, are identified during renovation or demolition activities, Arcadis recommends that these materials be considered regulated until they are inspected by an appropriately certified inspector and proven otherwise.
- Utilities/services, including electric, water, and heat, were active in most areas surveyed. Materials associated with electrical components and energized equipment were not safely accessible and were not sampled.

Table

Table 1. Asbestos Homogeneous Areas Summary
IDOT - Asbestos Abatement Survey
WO # 48
201 E. Fayette Avenue, Effingham, Illinois

HA No.	Material Description	Material Location	Sample Number	Condition	Friability	Asbestos Content	Estimated Quantity	Unit	Notes
1	White Popcorn Ceiling	Bedroom 3, Living Room 2	1A, 1B, 1C	Good	Friable	Chrysotile 1-5%	600	SF	
2	White and Beige Ceramic Wall Tile	Kitchenette, Bathroom 1, Living Room 2	2A, 2B, 2C	Good	Non-Friable	NAD	96	SF	
3	Beige 12" x 12" Floor Tile	Kitchenette, Living Room 2	3A, 3B, 3C	Good	Non-Friable	NAD	91	SF	
4	Black Mastic associated with HA-3	Kitchenette, Living Room 2	4A, 4B, 4C	Good	Non-Friable	NAD	91	SF	
5	Brown 12" x 12" Floor Tile	Bathroom 1, Bathroom 2, Kitchen, Hallway	5A, 5B, 5C	Good	Non-Friable	NAD	326	SF	
6	Beige Mastic associated with HA-5	Bathroom 1, Bathroom 2, Kitchen, Hallway	6A, 6B, 6C	Good	Non-Friable	NAD	326	SF	
7	White Window Caulk	Bedroom 3, Living Room 2, Kitchen, Bedroom 2, Dining Room, Bedroom 1, Bathroom 1	7A, 7B, 7C	Good	Non-Friable	NAD	1,500	LF	Interior and exterior windows
8	Blue and Brown 9" x 9" Floor Tile	Enclosed Porch	8A, 8B, 8C	Good	Non-Friable	NAD	405	SF	
9	Beige Mastic associated with HA-8	Enclosed Porch	9A, 9B, 9C	Good	Non-Friable	NAD	405	SF	
10	White Gypsum Board	Bedroom 3, Living Room 2	10A, 10B, 10C	Good	Non-Friable	NAD	900	SF	
11	Beige Drywall Tape associated with HA-10	Bedroom 3, Living Room 2	11A, 11B, 11C	Good	Non-Friable	NAD	900	SF	
12	White Joint Compound associated with HA-10	Bedroom 3, Living Room 2	12A, 12B, 12C	Good	Friable	NAD	900	SF	
13	White 12" x 12" Ceiling Tile (pinhole)	Enclosed Porch	13A, 13B, 13C	Good	Friable	NAD	405	SF	
14	White 16" x 16" Ceiling Tile	Hallway	14A, 14B, 14C	Good	Friable	NAD	64	SF	
15	White 12" x 12" Ceiling Tile	Living Room	15A, 15B, 15C	Good	Friable	NAD	351	SF	

Table 1. Asbestos Homogeneous Areas Summary
IDOT - Asbestos Abatement Survey
WO # 48
201 E. Fayette Avenue, Effingham, Illinois

HA No.	Material Description	Material Location	Sample Number	Condition	Friability	Asbestos Content	Estimated Quantity	Unit	Notes
16	Red Brick	House Exterior	16A, 16B, 16C	Good	Non-Friable	NAD	5,480	SF	
17	Red Mortar associated with HA-16	House Exterior	17A, 17B, 17C	Good	Non-Friable	NAD	5,480	SF	
18	White Grout associated with HA-2	Kitchenette, Bathroom 1	18A, 18B, 18C	Good	Non-Friable	NAD	96	SF	
19	Beige Adhesive associated with HA-2	Kitchenette, Bathroom 1	19A, 19B, 19C	Good	Non-Friable	NAD	96	SF	
20	White Troweled-on Material	North and West Side of Front Porch	20A, 20B, 20C	Good	Friable	NAD	120	SF	
21	Brown Fiberboard Siding	Exterior Siding on Garage	21A, 21B, 21C	Good	Non-Friable	NAD	600	SF	
22	Black Asphalt Shingles	House Roof	22A, 22B, 22C	Good	Non-Friable	NAD	2,400	SF	
23	Black Felt Paper associated with HA-22	House Roof	23A, 23B, 23C	Good	Non-Friable	NAD	2,400	SF	
24	Black Asphalt Shingles	Garage Roof	24A, 24B, 24C,	Good	Non-Friable	NAD	700	SF	
25	Black Felt Paper associated with HA-24	Garage Roof	25A, 25B, 25C	Good	Non-Friable	NAD	700	SF	
26	Gray Plaster	Interior Rooms except East and West Walls of Living Room 2, and Bedroom 3	26A, 26B, 26C, 26D, 26E	Good	Non-Friable	NAD	4,900	SF	
27	Gray Concrete Foundation	House Foundation, Garage Foundation, Driveway	27A, 27B, 27C	Good	Non-Friable	NAD	2,900	SF	

Notes:

ACM = Asbestos-Containing Material

Assumed ACM = A material determined by the inspector to be suspect ACM and is considered asbestos-containing until laboratory analysis can prove otherwise.

NAD = No Asbestos Detected

EA = Each

LF = Linear Foot

SF = Square Foot

Figures



Approximate Scale: 1 in. = 8 ft.

Route: US 40, IL 33 (FAP 95) Parcel 7004124
201 E. Fayette Avenue
Effingham, Effingham County, Illinois
ASBESTOS ABATEMENT SURVEY

SAMPLING LOCATIONS - ROOF & EXTERIOR




FIGURE

1

NOTE

BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

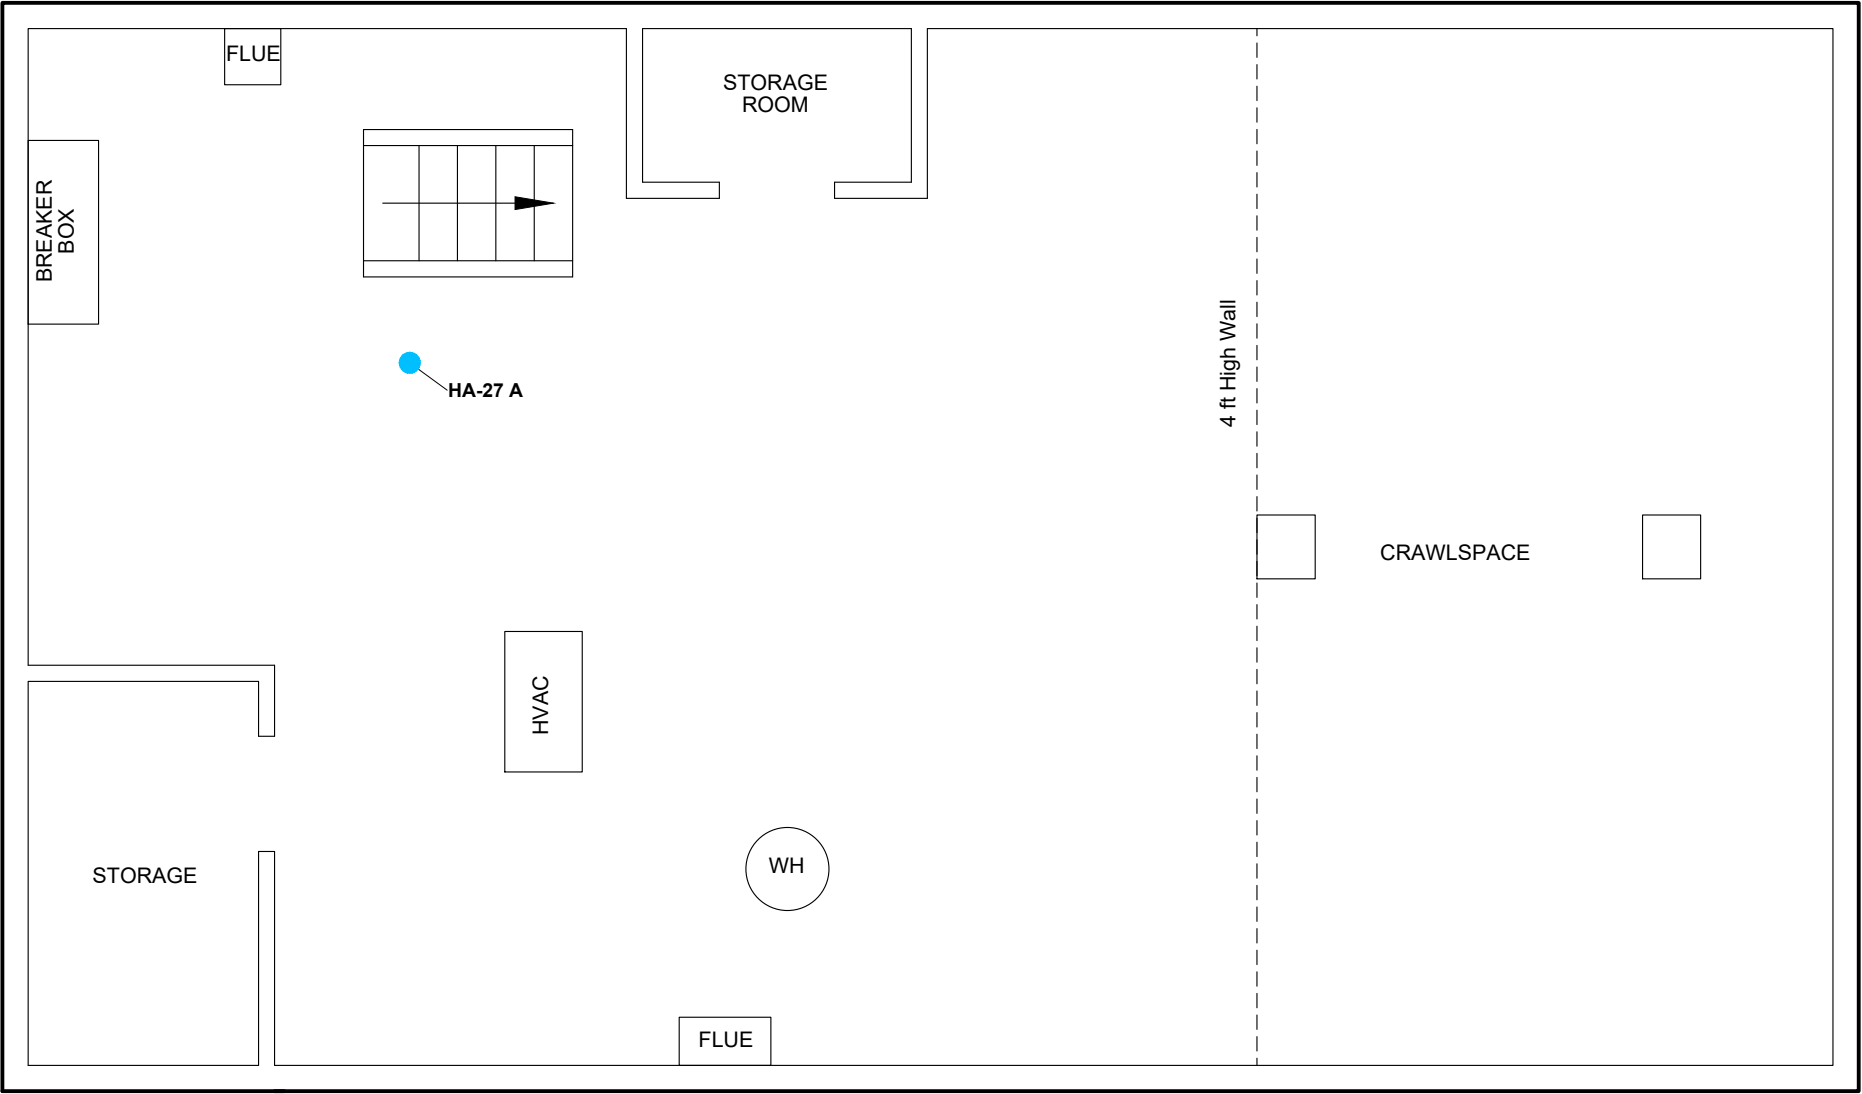

LEGEND

● ASBESTOS SAMPLE



Approximate Scale: 1 in. = 5 ft.

30296440 - IDOT / Asbestos Surveys WO #48
Job No. R-97-004-20
Route: US 40, IL 33 (FAP 95) Parcel 7004124
201 E. Fayette Avenue
Effingham, Effingham County, Illinois
ASBESTOS ABATEMENT SURVEY

**SAMPLING LOCATIONS -
BASEMENT**



FIGURE

2

NOTE
BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

G:\Shared drives\Projects\2025.0653 - IDOT - Arcadis Work Order 48\CADD\2025.0653_CADD_Arcadis WO #48 - 201 E Fayette Ave, Effingham, IL_SC_20250923.dwg LAYOUT: 3 - SAVED: 9/23/2025 1:37 PM ACADVER: 25.1S (LMS TECH) PAGESETUP: --- PLOTSTYLETABLE: ACAD.CTB PLOTTED: 9/23/2025 1:38 PM BY: SARAH CLARK



LEGEND
● ASBESTOS SAMPLE



Approximate Scale: 1 in. = 5 ft.


30296440 - IDOT / Asbestos Surveys WO #48
Job No. R-97-004-20
Route: US 40, IL 33 (FAP 95) Parcel 7004124
201 E. Fayette Avenue
Effingham, Effingham County, Illinois
ASBESTOS ABATEMENT SURVEY

**SAMPLING LOCATIONS -
FIRST FLOOR**



FIGURE
3

NOTE
BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

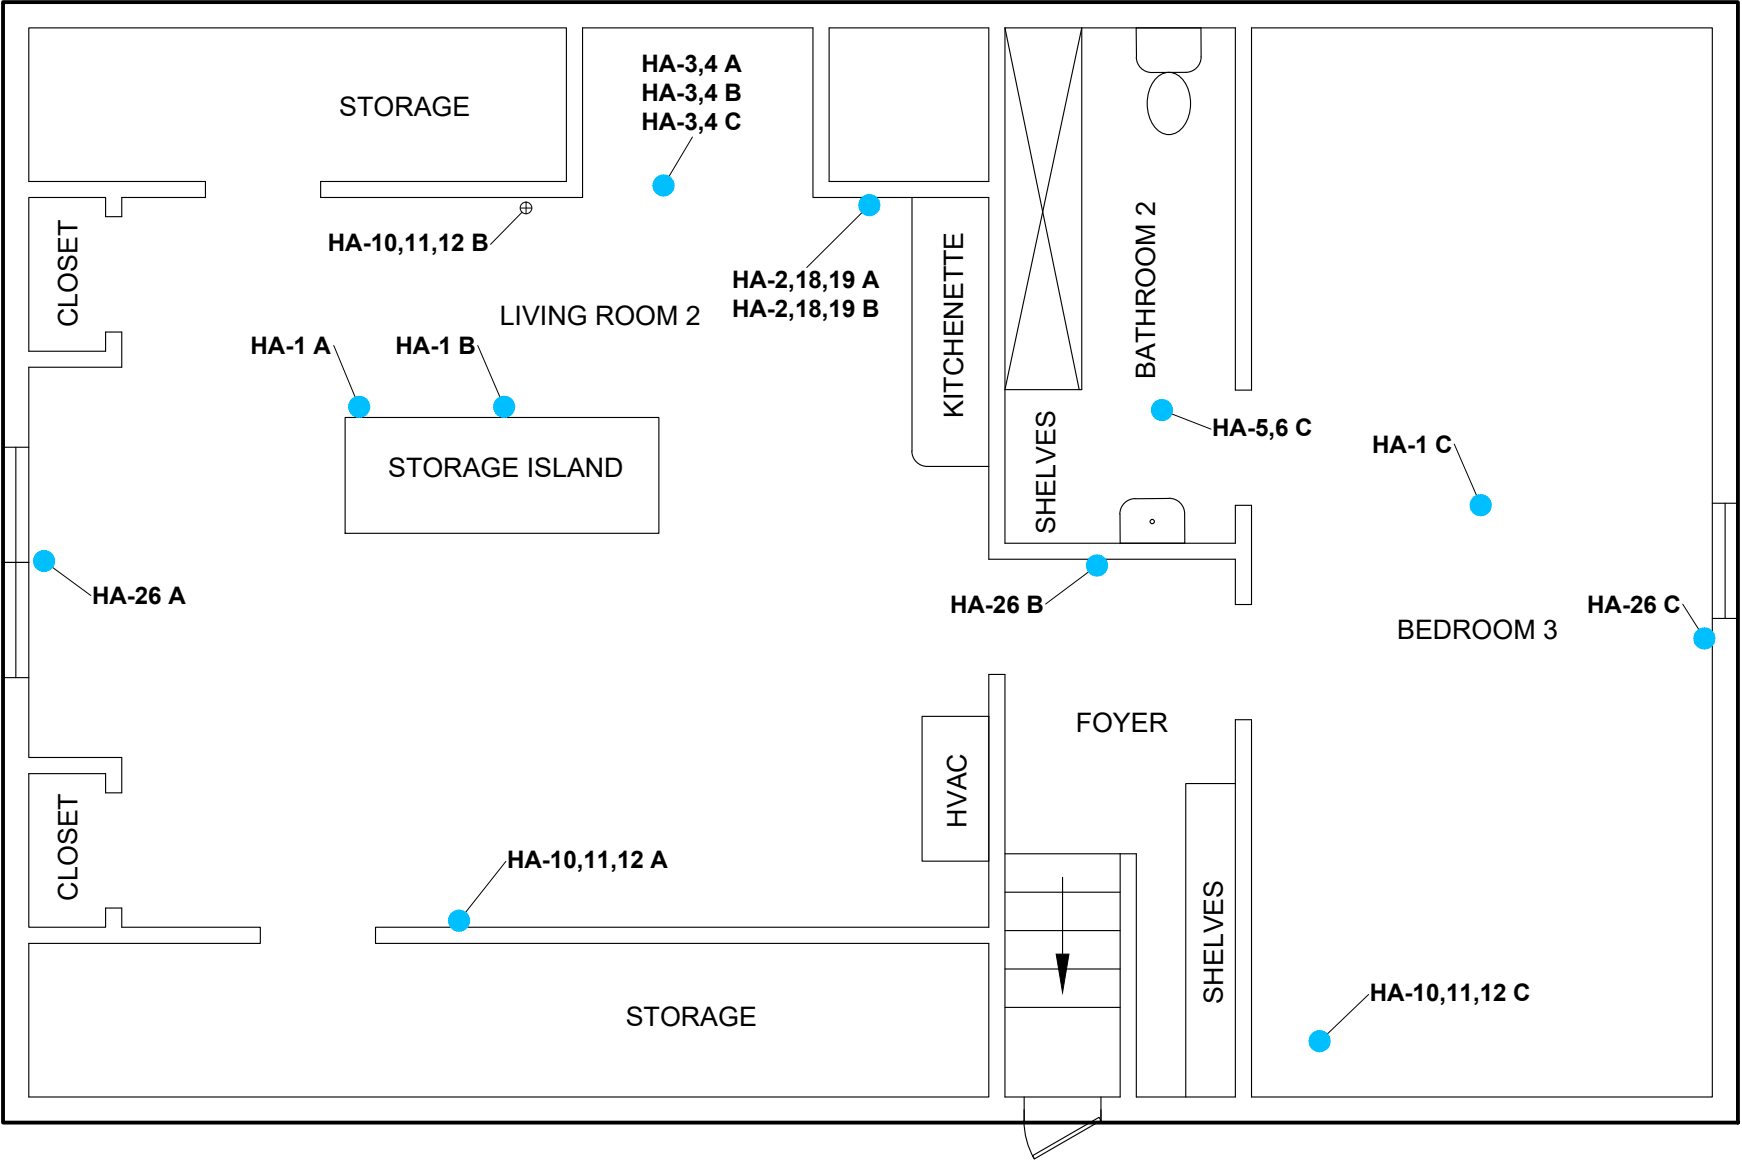

LEGEND
● ASBESTOS SAMPLE



Approximate Scale: 1 in. = 5 ft.


30296440 - IDOT / Asbestos Surveys WO #48
Job No. R-97-004-20
Route: US 40, IL 33 (FAP 95) Parcel 7004124
201 E. Fayette Avenue
Effingham, Effingham County, Illinois
ASBESTOS ABATEMENT SURVEY

**SAMPLING LOCATIONS -
SECOND FLOOR**



NOTE
BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

G:\Shared drives\Projects\2025\0653 - IDOT - Arcadis Work Order 48\CADD\2025\0653_CADD_Arcadis WO #48 - 201 E Fayette Ave, Effingham, IL_SC_20250923.dwg LAYOUT: 5 SAVED: 9/23/2025 1:37 PM ACADIVER: 2515 (LMS TECH) PAGESETUP: --- PLOTSTYLETABLE: ACAD.CTB PLOTTED: 9/23/2025 1:38 PM BY: SARAH CLARK

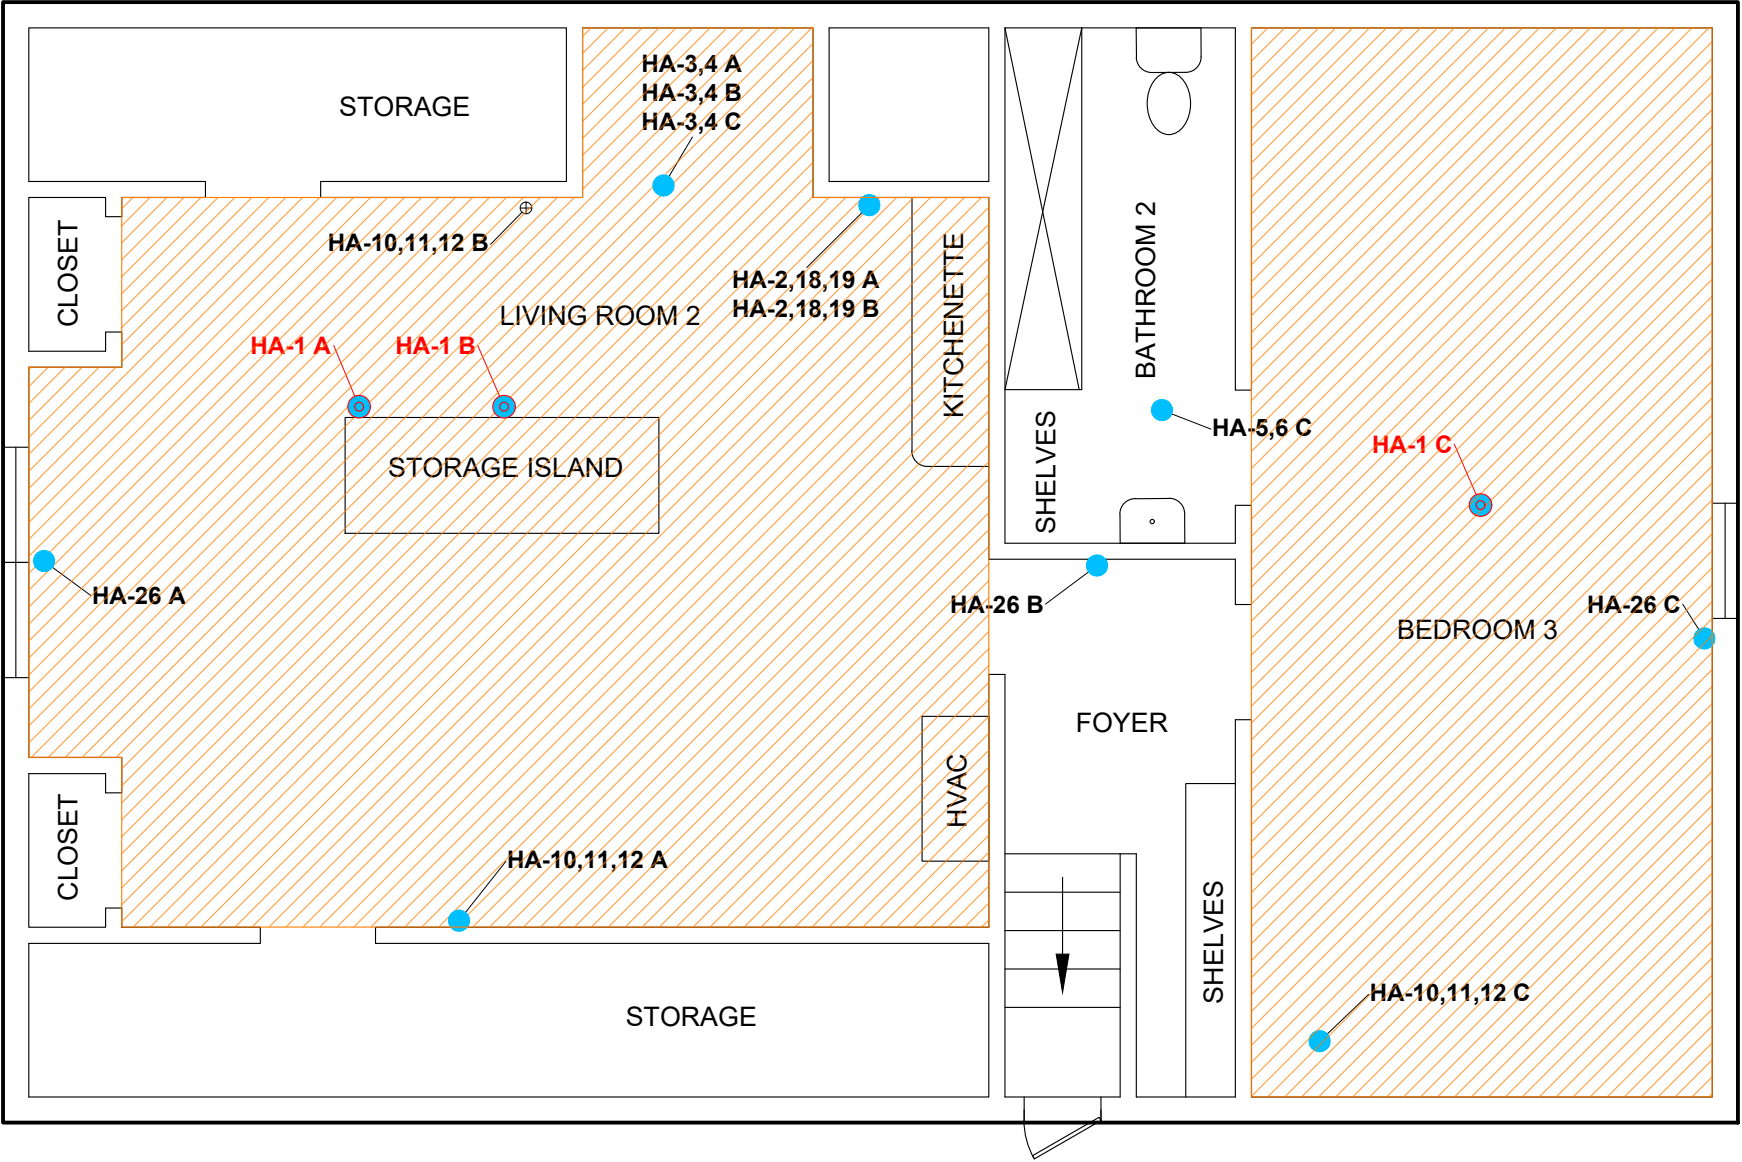

- LEGEND**
- ASBESTOS SAMPLE
 - ⊙ POSITIVE SAMPLE
 - HA-1: White Popcorn Ceiling



Approximate Scale: 1 in. = 5 ft.

30296440 - IDOT / Asbestos Surveys WO #48
Job No. R-97-004-20
Route: US 40, IL 33 (FAP 95) Parcel 7004124
201 E. Fayette Avenue
Effingham, Effingham County, Illinois
ASBESTOS ABATEMENT SURVEY

**ASBESTOS CONTAINING MATERIAL
LOCATIONS - SECOND FLOOR**



FIGURE
5

NOTE
BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

Appendix A

Limitations and Service Constraints

Limitations and Service Constraints

The opinions, conclusions and recommendations presented in this report are limited to the information obtained during the performance of the specific scope of service identified in the report. To the extent that Arcadis relied upon any information prepared by other parties not under direct contract to Arcadis, no representation as to the accuracy or completeness of such information is made. This report is an instrument of professional service and the services described in the report were performed in accordance with generally accepted standards and level of skill and care ordinarily exercised by members of the profession working under similar conditions including comparable budgetary and schedule constraints. No warranty, guarantee or certification express or implied, is intended or given with respect to Arcadis' services, opinions, conclusions, or recommendations. This statement is in lieu of any other statement either expressed or implied.

Arcadis' observations, the results of testing and Arcadis' opinions, conclusions and recommendations apply solely to conditions existing at the specific times when and specific locations where Arcadis' investigative work was performed. Arcadis affirms that data gathered and presented by Arcadis in this report was collected in an appropriate manner in accordance with generally accepted methods and practices. Arcadis cannot be responsible for decisions made by our client solely on the basis of economic factors. Observation and testing activities such as those conducted by Arcadis are inherently limited and do not represent a conclusive or complete characterization. Arcadis analyzed only the substances, conditions and locations described in the report at the time indicated. Conditions in other parts of the project site, building or area may vary from conditions at the specific locations where observations were made and where testing was performed by Arcadis. Additionally, other building material hazards which were not identified by Arcadis, may also be present in inaccessible areas, including within walls and cavities, above ceilings, and below floors. Therefore, the extent of Arcadis' opinions, conclusions and recommendations are limited and 100% confidence in these opinions, conclusions and recommendations cannot reasonably be achieved. Nothing contained in this report shall relieve any other party of its responsibility to abide by contract documents and applicable laws, codes, regulations, or standards nor shall it be considered medical advice or consultation.

This report is expressly for the sole and exclusive use of the party for whom this report was originally prepared and for the particular purpose outlined in the report. Only the party for whom this report was originally prepared and/or other specifically named parties have the right to make use of and rely upon this report. Reuse of this report or any portion thereof for other than its intended purpose, or if modified, or if used by third parties, shall be at the user's sole risk. This report must be presented in its entirety.

Appendix B

Accreditations

Inspector

Laboratory



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER

100 - 20504

ISSUED

6/17/2025

EXPIRES


05/15/2026

ANTHONY F SPALLA

611 East Cass Street

Joliet, IL 60432

Environmental Health

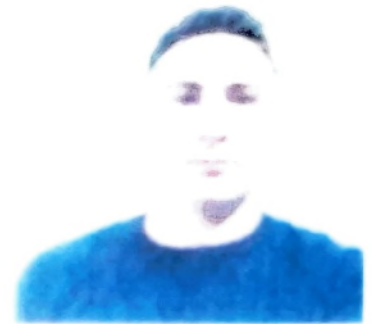

ENDORSEMENTS

INSPECTOR

TC EXPIRES

8/5/2025

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

PATRICK W HOOK
2025 WOODLANE DR
LINDENHURST, IL 60046

3/10/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 10967

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

			ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER			ISSUED	EXPIRES	INSPECTOR	1/10/2026
100 - 10967			3/10/2025	05/15/2026	PROJECT MANAGER	1/11/2026
PATRICK W HOOK 2025 WOODLANE DR LINDENHURST, IL 60046 Environmental Health					Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

United States Department of Commerce
National Institute of Standards and Technology



Certificate of Accreditation to ISO/IEC 17025:2017

NVLAP LAB CODE: 101202-0

STAT Analysis Corporation
Chicago, IL

*is accredited by the National Voluntary Laboratory Accreditation Program for specific services,
listed on the Scope of Accreditation, for:*

Asbestos Fiber Analysis

*This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017.
This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality
management system (refer to joint ISO-ILAC-IAF Communiqué on ISO/IEC 17025).*

2025-07-01 through 2026-06-30

Effective Dates



A handwritten signature in blue ink, appearing to read "R. K. Knech".

For the National Voluntary Laboratory Accreditation Program

SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017

STAT Analysis Corporation

Sterling Labs

2242 W. Harrison Suite 200

Chicago, IL 60612

Joseph Gusek

Phone: 312-733-0551

Email: jgusek@thesterlinglab.com

www.thesterlinglab.com

ASBESTOS FIBER ANALYSIS

NVLAP LAB CODE 101202-0

Bulk Asbestos Analysis

Code

Description

18/A01

EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples

18/A03

EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials


Airborne Asbestos Analysis

Code

Description

18/A02

U.S. EPA's "Interim Transmission Electron Microscopy Analytical Methods-Mandatory and Nonmandatory-and Mandatory Section to Determine Completion of Response Actions" as found in 40 CFR, Part 763, Subpart E, Appendix A.

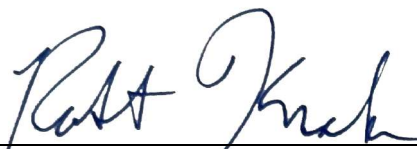

For the National Voluntary Laboratory Accreditation Program

Appendix C

Laboratory Reports

ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
225 W. Wacker Drive, Suite 2015
Chicago, IL 60606
Phone: (312) 575-3718

Reference: 30296440 Date Received: 09/09/2025
Location: IDOT WO#48, 201 E. Fayette Ave., Effingham, IL Date Analyzed: 09/11/2025
Batch No.: 376135 Date Reported: 09/11/2025
Customer No.: 2530 Turn Around Time: 5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135001	1A	Chrysotile 1-5%	Binder 95-99%
376135002	1B	Chrysotile 1-5%	Binder 95-99%
376135003	1C	Chrysotile 1-5%	Binder 95-99%
376135004	2A	ND	Cellulose 1-5% Binder 95-99%
376135005	2B	ND	Cellulose 1-5% Binder 95-99%
376135006	2C	ND	Cellulose 1-5% Binder 95-99%
376135007	3A	ND	Cellulose 1-5% Binder 95-99%
376135008	3B	ND	Cellulose 1-5% Binder 95-99%
376135009	3C	ND	Cellulose 1-5% Binder 95-99%
376135010	4A	ND	Cellulose 1-5% Binder 95-99%
376135011	4B	ND	Cellulose 1-5% Binder 95-99%

ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :



Daniel Mikos / Microscopist

Date: 09/11/2025

ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
 225 W. Wacker Drive, Suite 2015
 Chicago, IL 60606
 Phone: (312) 575-3718

Reference: 30296440 Date Received: 09/09/2025
 Location: IDOT WO#48, 201 E. Fayette Ave., Effingham, IL Date Analyzed: 09/11/2025
 Batch No.: 376135 Date Reported: 09/11/2025
 Customer No.: 2530 Turn Around Time: 5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135012	4C	ND	Cellulose 1-5% Binder 95-99%
376135013	5A	ND	Cellulose 1-5% Binder 95-99%
376135014	5B	ND	Cellulose 1-5% Binder 95-99%
376135015	5C	ND	Cellulose 1-5% Binder 95-99%
376135016	6A	ND	Cellulose 1-5% Binder 95-99%
376135017	6B	ND	Cellulose 1-5% Binder 95-99%
376135018	6C	ND	Cellulose 1-5% Binder 95-99%
376135019	7A	ND	Cellulose 1-5% Binder 95-99%
376135020	7B	ND	Cellulose 1-5% Binder 95-99%
376135021	7C	ND	Cellulose 1-5% Binder 95-99%

ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :


 Daniel Mikos / Microscopist

ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
 225 W. Wacker Drive, Suite 2015
 Chicago, IL 60606
 Phone: (312) 575-3718

Reference:	30296440	Date Received:	09/09/2025
Location:	IDOT WO#48, 201 E. Fayette Ave., Effingham, IL	Date Analyzed:	09/11/2025
Batch No.:	376135	Date Reported:	09/11/2025
Customer No.:	2530	Turn Around Time:	5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135022	8A	ND	Cellulose 1-5% Binder 95-99%
376135023	8B	ND	Cellulose 1-5% Binder 95-99%
376135024	8C	ND	Cellulose 1-5% Binder 95-99%
376135025	9A	ND	Cellulose 1-5% Binder 95-99%
376135026	9B	ND	Cellulose 1-5% Binder 95-99%
376135027	9C	ND	Cellulose 1-5% Binder 95-99%
376135028	10A	ND	Cellulose 10-15% Binder 85-90%
376135029	10B	ND	Cellulose 10-15% Binder 85-90%
376135030	10C	ND	Cellulose 10-15% Binder 85-90%
376135031	11A	ND	Cellulose 60-65% Binder 35-40%

ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :


 Daniel Mikos / Microscopist

Date: 09/11/2025

ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
225 W. Wacker Drive, Suite 2015
Chicago, IL 60606
Phone: (312) 575-3718

Reference: 30296440 Date Received: 09/09/2025
Location: IDOT WO#48, 201 E. Fayette Ave., Effingham, IL Date Analyzed: 09/11/2025
Batch No.: 376135 Date Reported: 09/11/2025
Customer No.: 2530 Turn Around Time: 5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135032	11B	ND	Cellulose 60-65% Binder 35-40%
376135033	11C	ND	Cellulose 60-65% Binder 35-40%
376135034	12A	ND	Cellulose 1-5% Binder 95-99%
376135035	12B	ND	Cellulose 1-5% Binder 95-99%
376135036	12C	ND	Cellulose 1-5% Binder 95-99%
376135037	13A	ND	Cellulose 80-85% Binder 15-20%
376135038	13B	ND	Cellulose 80-85% Binder 15-20%
376135039	13C	ND	Cellulose 80-85% Binder 15-20%
376135040	14A	ND	Cellulose 80-85% Binder 15-20%
376135041	14B	ND	Cellulose 80-85% Binder 15-20%

ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :



ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
225 W. Wacker Drive, Suite 2015
Chicago, IL 60606
Phone: (312) 575-3718

Reference: 30296440 Date Received: 09/09/2025
Location: IDOT WO#48, 201 E. Fayette Ave., Effingham, IL Date Analyzed: 09/11/2025
Batch No.: 376135 Date Reported: 09/11/2025
Customer No.: 2530 Turn Around Time: 5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135042	14C	ND	Cellulose 80-85% Binder 15-20%
376135043	15A	ND	Cellulose 35-40% Binder 60-65%
376135044	15B	ND	Cellulose 35-40% Binder 60-65%
376135045	15C	ND	Cellulose 35-40% Binder 60-65%
376135046	16A	ND	Cellulose 1-5% Binder 95-99%
376135047	16B	ND	Cellulose 1-5% Binder 95-99%
376135048	16C	ND	Cellulose 1-5% Binder 95-99%
376135049	17A	ND	Cellulose 1-5% Binder 95-99%
376135050	17B	ND	Cellulose 1-5% Binder 95-99%
376135051	17C	ND	Cellulose 1-5% Binder 95-99%

ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :


Daniel Mikos / Microscopist

Date: 09/11/2025

ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
225 W. Wacker Drive, Suite 2015
Chicago, IL 60606
Phone: (312) 575-3718

Reference: 30296440 Date Received: 09/09/2025
Location: IDOT WO#48, 201 E. Fayette Ave., Effingham, IL Date Analyzed: 09/11/2025
Batch No.: 376135 Date Reported: 09/11/2025
Customer No.: 2530 Turn Around Time: 5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135052	18A	ND	Cellulose 1-5% Binder 95-99%
376135053	18B	ND	Cellulose 1-5% Binder 95-99%
376135054	18C	ND	Cellulose 1-5% Binder 95-99%
376135055	19A	ND	Cellulose 1-5% Binder 95-99%
376135056	19B	ND	Cellulose 1-5% Binder 95-99%
376135057	19C	ND	Cellulose 1-5% Binder 95-99%
376135058	20A	ND	Cellulose 1-5% Binder 95-99%
376135059	20B	ND	Cellulose 1-5% Binder 95-99%
376135060	20C	ND	Cellulose 1-5% Binder 95-99%
376135061	21A	ND	Cellulose 80-85% Binder 15-20%


ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :

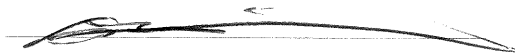
Daniel Mikos / Microscopist

Date: 09/11/2025

ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
225 W. Wacker Drive, Suite 2015
Chicago, IL 60606
Phone: (312) 575-3718

Reference: 30296440 Date Received: 09/09/2025
Location: IDOT WO#48, 201 E. Fayette Ave., Effingham, IL Date Analyzed: 09/11/2025
Batch No.: 376135 Date Reported: 09/11/2025
Customer No.: 2530 Turn Around Time: 5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135062	21B	ND	Cellulose 80-85% Binder 15-20%
376135063	21C	ND	Cellulose 80-85% Binder 15-20%
376135064	22A	ND	Binder 85-90% Glass 10-15%
376135065	22B	ND	Binder 85-90% Glass 10-15%
376135066	22C	ND	Binder 85-90% Glass 10-15%
376135067	23A	ND	Cellulose 60-65% Binder 35-40%
376135068	23B	ND	Cellulose 60-65% Binder 35-40%
376135069	23C	ND	Cellulose 60-65% Binder 35-40%
376135070	24A	ND	Binder 85-90% Glass 10-15%
376135071	24B	ND	Binder 85-90% Glass 10-15%


ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :

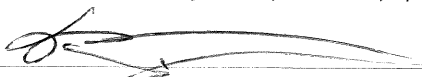

ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
225 W. Wacker Drive, Suite 2015
Chicago, IL 60606
Phone: (312) 575-3718

Reference: 30296440 Date Received: 09/09/2025
Location: IDOT WO#48, 201 E. Fayette Ave., Effingham, IL Date Analyzed: 09/11/2025
Batch No.: 376135 Date Reported: 09/11/2025
Customer No.: 2530 Turn Around Time: 5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135072	24C	ND	Binder 85-90% Glass 10-15%
376135073	25A	ND	Cellulose 60-65% Binder 35-40%
376135074	25B	ND	Cellulose 60-65% Binder 35-40%
376135075	25C	ND	Cellulose 60-65% Binder 35-40%
376135076	26A	ND	Cellulose 1-5% Binder 95-99%
376135077	26B	ND	Cellulose 1-5% Binder 95-99%
376135078	26C	ND	Cellulose 1-5% Binder 95-99%
376135079	26D	ND	Cellulose 1-5% Binder 95-99%
376135080	26E	ND	Cellulose 1-5% Binder 95-99%
376135081	27A	ND	Cellulose 1-5% Binder 95-99%

ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :


Daniel Mikos / Microscopist

Date: 09/11/2025

ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY

Method: EPA/600/R-93/116

Arcadis US Inc.
225 W. Wacker Drive, Suite 2015
Chicago, IL 60606
Phone: (312) 575-3718

Reference: 30296440 Date Received: 09/09/2025
Location: IDOT WO#48, 201 E. Fayette Ave., Effingham, IL Date Analyzed: 09/11/2025
Batch No.: 376135 Date Reported: 09/11/2025
Customer No.: 2530 Turn Around Time: 5 Days

Laboratory Sample	Customer Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
376135082	27B	ND	Cellulose 1-5% Binder 95-99%
376135083	27C	ND	Cellulose 1-5% Binder 95-99%

ND = Asbestos Not Detected (Not Present) NA = Not Analyzed NS = Not Submitted

Components of inhomogeneous samples are analyzed per our Standard Operating Procedure, or per customer request.

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory. This report remains property of STAT Analysis until payment is received in full (see invoice).

Analyzed by Name :

Daniel Mikos / Microscopist

Date: 09/11/2025



2242 W. Harrison, Suite 200, Chicago, Illinois 60612 Phone: (312) 733-0551 Fax: (312) 733-2386
e-mail address: info@thesterlinglab.com

CHAIN OF CUSTODY RECORD

Page : 7 of 7

Client:	Arcadi's	Turn Around:	Immediate:	☐	4 Hrs:	☐	8 Hrs:	☐	24 Hrs:	☐	1 Day:	☐	2 Days:	☐	3 Days:	☐	5 Days:	☒		
Street Address:	125 W. Wacker Dr	Date Due:	Time Due: Note: Not all turn around times are available for all analysis.																	
City, State, Zip:	Chicago, IL 60606	OFFICE USE ONLY BELOW:							Relinquished by: [Signature] Date/Time: 09/08/2025											
Phone:	779-220-0291	Batch No.:	376135							Received by: [Signature] Date/Time: 9/8/25 16:00										
Fax:		Samples Acceptable:	Yes:	☒	No:	☐	Relinquished by: [Signature] Date/Time:													
e-mail/Alt. Fax:	Anthony.Spall@arcadis.com	Checked by (Initial/Date):	JC 9/11/25							Received by: [Signature] Date/Time:										
Project Number:	302 96440	Comments:																		
Project Name:	IDOT WO#48																			
Project Location:	291 E. Fayette Ave. Effingham, IL																			
Project Manager:	Brendan Queally																			
P.O. Number:																				

[illegible]

Comments: Please email results to Brendan.Quealy@arcadis.com

376135

Client/Project

Site Address:

Project Number:

IDOT WO#48

Survey Date(s):

08/27/2025

Inspector:

Anthony Spalla, Patrick Hook



HA / Sample Number		Material Type (M, TSI, S)	Color	Texture	Material Description	Floor	Sample Location	Material Location(s)	Condition (G, D, SD)	Friable (Y / N)	Approx Quantity Units (SF/LF)	Photo #	
1	A	S	White	Rough	Popcorn Ceiling	2nd	Living Room 2	Bedroom 3.	G	Y	600SF	1	
	B	S											
	C	S					Bedroom 3	Living Room 2					
Comment / Notes:													
2	A	M	White + Beige	Smooth	ceramic Tile Wall Tile	2nd	Living Room 2	Kitchenette	G	N	96SF	2	
	B	S				2nd	Kitchenette	Bathroom 1					
	C	S				1st	Bathroom 1	Bathroom 1					
Comment / Notes													
3	A	M	Beige	Smooth	12x12 Floor Tile	2nd	Living Room 2	Kitchenette Living Room 2	G	N	91SF	3	
	B	S				2nd							
	C	S				2nd							
Comment / Notes Ceramic Tile look. 2nd Floor only													
4	A	M	Black	Rough	Mastic assoc. w/HA-3	2nd			G	N	91SF	4	
	B	S				2nd							
	C	S				2nd							
Comment / Notes													
5	A	M	Brown	Smooth	12x12 Floor Tile	1st	Kitchen	Bathroom 1, Bathroom 2	G	N	326SF	5	
	B	S				1st		Kitchen and Hallway					
	C	S				2nd	Bathroom 2						
Comment / Notes													
Comment / Notes													
6	A	M	Beige	Rough	Mastic assoc. w/HA-5	1st	Kitchen		G	N	326SF	6	
	B	S				1st							
	C	S				2nd	Bathroom 2						
Comment / Notes													

Re: Mr. Pajetta 7/8/25 16100

376135

Client/Project _____ Survey Date(s): _____
 Site Address: _____ Inspector: _____
 Project Number: _____



HA / Sample Number	Material Type (M, TSI, S)	Color	Texture	Material Description	Floor	Sample Location	Material Location(s)	Condition (G, D, SD)	Friable (Y / N)	Approx Quantity Units (SF/LF)	Photo #									
7	A	M	White	Smooth	Ext.	Ext. Porch	Bedroom 3, Living Room 2, Kitchen, Bedroom 2, Dining Room, Bedroom 1, Bathroom	G	N	1500 LF	7									
	B	S																		
	C	S																		
Comment / Notes: Interior and exterior windows																				
8	A	M	Blue + Brown	Smooth	Ext.	Enclosed Porch	Ext. Porch Enclosed	G	N	405 SF	8									
	B	S																		
	C	S																		
Comment / Notes																				
9	A	M	Beige	Rough	S	S	S	G	N	405 SF	9									
	B	S																		
	C	S																		
Comment / Notes																				
10	A	M	White	Smooth	2nd	Living Room 2	Bedroom 3, Living Room 2	G	N	900 SF	10									
	B	S																		
	C	S																		
Comment / Notes																				
11	A	M	Beige	Smooth	S	S	S	G	N	900 SF	11									
	B	S																		
	C	S																		
Comment / Notes																				
Comment / Notes																				
12	A	M	White	Rough	S	S	S	G	N	900 SF	12									
	B	S																		
	C	S																		
Comment / Notes																				

Reimbursement 7/8/15 16:00

376135

Client/Project

Survey Date(s):

Site Address:

Inspector:

Project Number:



HA / Sample Number	Material Type (M, TSI, S)	Color	Texture	Material Description	Floor	Sample Location	Material Location(s)	Condition (G, D, SD)	Friable (Y / N)	Approx Quantity Units (SF/LF)	Photo #	
13	A	M	White	Smooth	12X12 Ceiling Tile	1st	Enclosed Porch	Ext. Porch	G	N	405 SF	13
	B	S										
	C	S										
Comment / Notes: Pin Hole look												
14	A	M	White	Smooth	16X16 Ceiling Tile	{	Hallway	Hallway	G	N	64 SF	14
	B	S										
	C	S										
Comment / Notes												
15	A	M	White	Smooth	12X12 Ceiling Tile	{	Living Room	Living Room	G	N	35 SF	15
	B	S										
	C	S										
Comment / Notes												
16	A	M	Red	Rough	Brick	Ext.	SESW NE Corner NW Corner NE Corner	Ext. of House	G	N	5480 SF	16
	B	S										
	C	S										
Comment / Notes												
17	A	M	Red	Rough	Mortar assoc. w/HA-16	{	{	{	G	N	5480 SF	17
	B	S										
	C	S										
Comment / Notes												
Comment / Notes												
18	A	M	White	Rough	Grout assoc. w/HA-2	2nd 2nd 1st	Living Room 2 Kitchenette Bathroom 1	Kitchenette, Bathroom 1	G	N	96 SF	18
	B	S										
	C	S										
Comment / Notes												

Rec: Mr. Padgett 9/8/15 16:00

376135

Client/Project _____ Survey Date(s): _____
 Site Address: _____ Inspector: _____
 Project Number: _____



HA / Sample Number	Material Type (M, TSI, S)	Color	Texture	Material Description	Floor	Sample Location	Material Location(s)	Condition (G, D, SD)	Friable (Y / N)	Approx Quantity Units (SF/LF)	Photo #	
19	A	M	Beige	Smooth	Adhesive assoc. w/ HA-2	2nd	}	}	G	N	96SF	19
	B	S										
	C	S										
Comment / Notes:												
20	A	M	White	Rough	Troweled on Material	Ext.	NW Side of Porch	N. and -W. Side of front porch	G	N	120SF	20
	B	S										
	C	S										
Comment / Notes												
21	A	M	Brown	Rough	Fiber board Siding assoc. w/ Garage	Ext.	W. Side of Garage	Ext. Siding of Garage	G	N	600SF	21
	B	S										
	C	S										
Comment / Notes												
22	A	M	Black	Rough	Asphalt Shingles assoc. w/ Roof of House	R	W. Side of House	Roof of House	G	N	2400SF	22
	B	S										
	C	S										
Comment / Notes												
23	A	M	Black	Smooth	Felt Paper assoc. w/ HA-22	R	}	}	G	N	2400SF	23
	B	S										
	C	S										
Comment / Notes												
Comment / Notes												
24	A	M	Black	Rough	Asphalt Shingles assoc. w/ Garage	R	W. Side of Garage	Roof of Garage	G	N	700SF	24
	B	S										
	C	S										
Comment / Notes												

REC'D - PUGH 9/8/25 16100

376135

Client/Project _____ Survey Date(s): _____
 Site Address: _____ Inspector: _____
 Project Number: _____



HA / Sample Number	Material Type (M, TSI, S)	Color	Texture	Material Description	Floor	Sample Location	Material Location(s)	Condition (G, D, SD)	Friable (Y / N)	Approx Quantity Units (SF/LF)	Photo #
25	A	M	Black	Smooth				G	N	700SF	25
	B	S									
	C	S									
Comment / Notes:											
26	A	S	Gray	Rough	2nd	Living Room 2	Every Int. Room except E. and W. Walk of living Room 2 and Bedroom 3	G	N	4900SF	26
	B	S									
	C	S									
Comment / Notes											
26	D	S	Gray	Rough	1st	Living Room		G	N	4900SF	26
	E	S									
Comment / Notes											
27	A	M	Gray	Rough	B	Basement	Foundation of House and Garage w/Driveway	G	N	2900SF	27
	B	S									
	C	S									
Comment / Notes											
Comment / Notes											
Comment / Notes											
Comment / Notes											

Rec'd M. Polgott 9/8/15 16:00

Appendix D

Photo Log



Exterior of Building – Front




Exterior of the Building - Back




HA-1: White Popcorn Ceiling



HA-2: White and Beige Ceramic Wall Tile

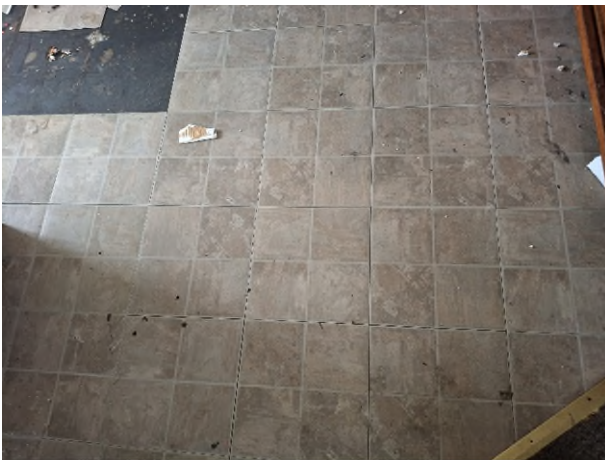

HA-3: Beige 12" x 12" Floor Tile
HA-4: Black Mastic associated with HA-3

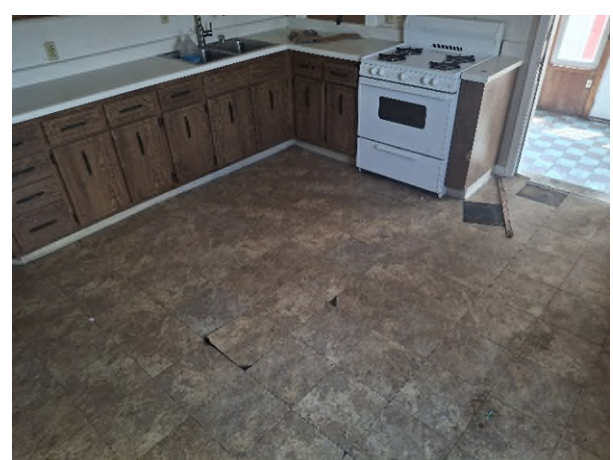

HA-5: Brown 12" x 12" Floor Tile



HA-6: Beige Mastic associated with HA-5



HA-7: White Window Caulk



HA-8: Blue and Brown 9" x 9" Floor Tile



HA-9: Beige Mastic associated with HA-8



HA-10: White Gypsum Board




HA-11: Beige Drywall Tape associated with HA-10
HA-12: White Joint Compound associated with HA-10



HA-13: White 12" x 12" Ceiling Tile (pinhole)



HA-14: White 16" x 16" Ceiling Tile

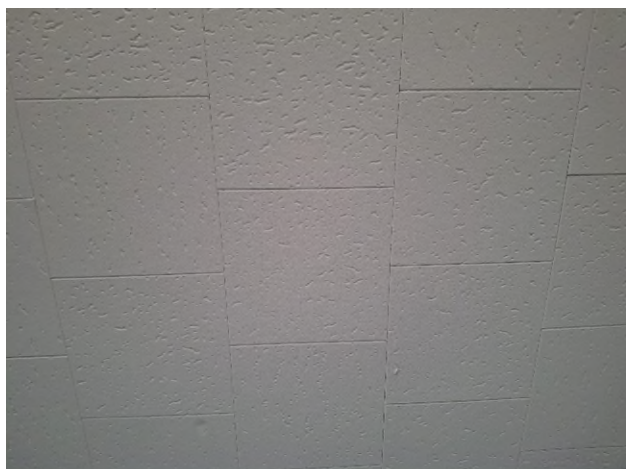

HA-15: White 12" x 12" Ceiling Tile



HA-16: Red Brick
HA-17: Red Mortar associated with HA-16



HA-18: White Grout associated with HA-2
HA-19: Beige Adhesive associated with HA-2



HA-20: White Troweled on Material



HA-21: Brown Fiberboard Siding



HA-22: Black Asphalt Roof Shingles



HA-23: Black Felt Paper under HA-22



HA-24: Black Asphalt Roof Shingles



HA-25: Black Felt Paper associated with HA-24



HA-26: Gray Plaster



HA-27: Gray Concrete Foundation

Arcadis U.S., Inc.
225 West Wacker Drive
Suite 2015
Chicago, Illinois 60606
Phone: 312 917 1000
www.arcadis.com